

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In: Wexford Located In _____ Corner Code # _____
(County)


- | | | | | | |
|--------------------------------------|---|------------|---|------------|------------|
| 1. Public Land Survey | T | <u>24N</u> | R | <u>11W</u> | <u>E11</u> |
| | T | _____ | R | _____ | _____ |
| 2. Property Controlling in Section | S | _____ | T | _____ | R |
| | S | _____ | T | _____ | R |
| 3. Miscellaneous Property in Section | S | _____ | T | _____ | R |
| | S | _____ | T | _____ | R |

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

I, Craig W. McVean, in a field survey on April 22, 2003 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

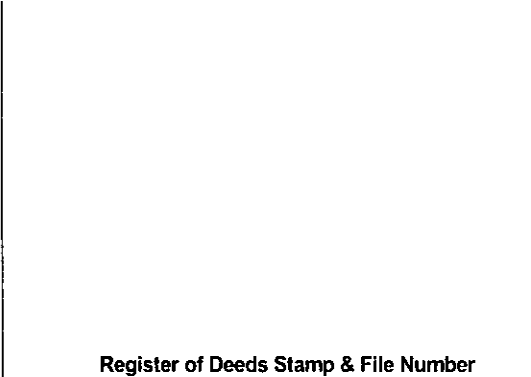

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

E11 - GLO - Hemlock 16" dia corner - J. Brink - 1839

- Fargo - 1913 - No US Evidence
- Set iron pipe and crockery
- W Ash 13" S30 $\frac{1}{4}$ "W 44 L.; Hemlock stp. 16" N65 $\frac{1}{2}$ "W 14 L.;
- Hemlock stp. 18" N36"E 26 L.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

E11 - Sec. corner common to Sec. 28, 29, 32 & 33 - Found $\frac{3}{4}$ " I.D. x 2.5' iron pipe with hooked end on S. slope of hillside - leaning down hill - straightened for point. Removed pipe and found two butter dishes. Fargo's Witnesses to pipe are gone. Fargo position established by double proportion to GLO. Accepted Fargo pipe as a careful and faithful re-establishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E11 - Replaced Fargo's $\frac{3}{4}$ " pipe with 4" DNR Alum. Cap on 1" x 36" galv. Iron pipe in ring of stones. Placed one butter dish at base of monument as memorial.

- Set Blue Carsonite Post 1' N
- N57°W 10.50' to set N & T in NE side 9" R. Oak scribed 'XBT'
- N53°E 39.43' to set N & T in NW side 4" Beech scribed 'XBT'
- S25°E 31.85' to set N & T in E side 10" S. Maple scribed 'XBT'
- S58°W 23.67' to set N & T in N side 7" R. Maple scribed 'XBT'



Signed by: Craig W. McVean
Surveyor's Michigan License No.: 39088

Date: 11/10/2003