

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 24 N. R. 12 W.	F-6; G-5; G-6
2. PROPERTY CONTROLLING IN SECTION 16	T. 24 N. R. 12 W.	15
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 21, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A - Description of original monument and accessories and subsequent restoration:

C. (CONTINUED)

15
1 1/4"x30" pipe-cedar post w/loc. tag
12" Maple N03°W 11.3
8" Maple S81°W 20.8
9" Maple S13°W 18.8
12" Maple N73°E 24.5

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- F-6 Etab. center of Sec. 16 at intersection of 1/4 lines. Could not locate any old records of survey for split-up of this sec. even though there is an old rd. grade near the E-W 1/4 line & the sec. appears to have been split & occupied at one time. Fns. are highly irreg. in sec.
- G-5 Fd. 1"x2 1/2"x48" iron bar w/wood & rocks in road intersection N-S-E-W. *Fits W. Johnson Wits, 1916.*
- G-6 Restored 1/4 corner on straight line between sec. corners to N & S & on split of R-O-W fences & ctr. of rd. to E. Corner also is in line w/old fn. posts (down) to S. Corner falls in "T" rd. intersection (N-S-E) w/old twp rd. grade to W. Corner is in rd. fill & 1916 notes by Deputy Co. Sur. Johnson indicate 1/4 cor. as lost by rd. grading. Comp. 1/4 cor. position by proportion between sec. corners to N & S would be 5' N.
- 15 Established 1/16 corner per standard B.L.M. instructions

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-6	G-5	G-6
Drove 1 1/4"x36" pipe & set cedar post w/loc. tag	Set std. Wexford Co. Monument	Set Wexford Co. mon. (buried) in gravel county road
12" Maple S70°E 35.0	40" Elm N22°W 49.22	10" Maple (clmp. of 4)
14" Maple S40°E 38.1	10" R. Pine N59°E 49.95	N70°W 80.4
12" Twn Maple S15°W 42.0	9" R. Pine N30°E 63.96	13" Cherry S84°W 118.1
N-S fn. remains Due W 16'±	Set cedar post w/loc. tag	5" R. Pine S32°E 83.9
Old E-W twp. rd. Due N 13'±	S45°W 47'	Center N-S gravel rd. Due W 17'±
grade		Set cedar post w/loc. tag
		N45°E 47.0

SIGNED BY Carl F. Roser 4-28-77 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

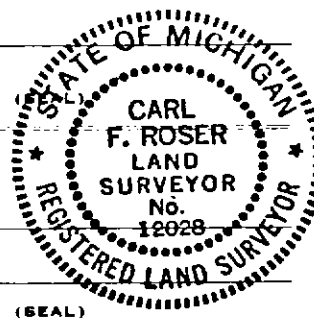

WEXFORD TOWNSHIP
WEXFORD COUNTY

SURVEYOR'S MICHIGAN REGISTRATION NO. _____