

ALLEGAN COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

COMMISSION

For corners in

Allegan (County)	Located in:	Corner Code #
1. Public Land Survey	T <u>4N</u> R <u>16W</u>	<u>L-1 (N 1/4 Sec 1)</u>
	T _____ R _____	<u>Laketown-Twp.</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

1993 DEC 30 PM 2:45
 REGISTER OF DEEDS
 ALLEGAN COUNTY MICHIGAN
James A. DeBorja

FILED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, David R. Greer, in a field survey on November 22, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


L-1
 Corner not set by Government
 Recorded in Liber 3, Page 376, March 27, 1984
 3"8" iron in monument box
 PK in SE'ly Side Power Pole SW 37.60'
 PK in SW'ly Side Power Pole SE 61.67'
 SE Cor School Bldg. NW 62.79'
 Capped Iron in Mon. Box E 34.39'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

L-1
 Found steel bar in monument box on Township line (S Sec 36, T5N, R16W). This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner.
 SE Cor School Bldg NW 62.80'
 Capped Iron E 34.40'

C. Description of monument for corner and accessories established to perpetuate localing the position of the corner:

L-1
 Replaced steel bar in monument box with A.C. Remonumentation Iron & Cap on S line, Sec 36, T5N, R16W
 AZ - Michigan State Grid Direction
 D.C. Remon iron L-13 S1/4, Sec 36, T5N R16W AZ. 90°00'33" 34.40'
 SE Cor School, Brick AZ. 337°27' 62.80'
 SW Cor School, Brick AZ. 289°22' 175.37'
 SW Cor House, Brick AZ. 62°22' 137.66'
 SW Cor House, Foundation AZ. 156°57' 133.81'

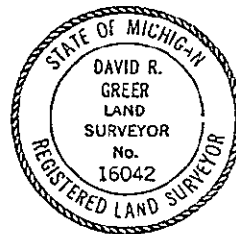

Signed by David R. Greer

Date 11/22/93

Surveyor's Michigan License No. 16042

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 26, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1982