

BARRY COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SURVEY &
REMONUMENTATION

SPR 04 2000

SECTION

For Corners in
BARRY
(county)

Located In: Corner Code #

1. Public Land Survey
NORTH 1/4 CORNER
SECTION 3
JOHNSTOWN TOWNSHIP
ON TOWNSHIP LINE

T 1N R 8W
T _____ R _____
T _____ R _____
T _____ R _____

H-1



2810

Page: 1 of 1
12/07/1999 08:36A

Darla K. Burghdoff - Barry Co. LCRCR

Register of Deeds Stamp & File Number

2. Property Controlling
in Section S _____ T _____ R _____
S _____ T _____ R _____

3. Miscellaneous S _____ T _____ R _____

4. Lot No _____ Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Brian Reynolds, in a field survey on 6 OCTOBER, 1999 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. THIS CORNER WAS NOT SET BY THE GENERAL LAND OFFICE.
2. NO MENTION OF THIS CORNER COULD BE FOUND IN THE COUNTY SURVEYOR RECORDS:

*** NO HISTORICAL INFORMATION, PUBLIC OR PRIVATE, AVAILABLE FOR THIS CORNER ***

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND NO MAGNETIC EVIDENCE OF CORNER MONUMENTATION. FOUND WELL POINT FOR THE STANDARD CORNER AT G-13, T2N, R8W, BALTIMORE TOWNSHIP. TRAVERSED THE NORTH LINE OF SECTION 3 AND FOUND NO MONUMENTATION AT H-1 OR H-13 (T2N, R8W). FOUND IRONS REPRESENTING I-1 & I-13 (T2N, R8W) AS RECITED IN L.C.R.C. #123, BY JAMES L. KING, P.S. #14766. TRAVERSED THE TOWN LINE FURTHER EAST TO I-13, FOUND AN IRON SET BY KING IN REFERENCE TO AN ORIGINAL GLO WITNESS. BASED ON REVIEW OF MEASUREMENTS AND OCCUPATION LINES, DISREGARDED FOUND MONUMENTS AT I-13 & I-1 BY KING. RESTORED I-13 AT LOCATION THAT BEST FIT ALL MEASUREMENTS AND OCCUPATION. RESTORED G-1 AND I-1 AT GOVERNMENT JOG ON TOWNSHIP LINE. RESTORED H-1 AT MID-POINT ON TOWNSHIP LINE BETWEEN G-1 AND I-1. SET STANDARD BARRY COUNTY REMONUMENTATION MONUMENT ON TOWNSHIP LINE G-13 TO I-13 (T2N, R8W) AND AT THE MID POINT BETWEEN RESTORED G-1 AND RESTORED I-1.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET STANDARD BARRY COUNTY REMONUMENTATION MONUMENT (3/4" X 36" IRON) WITH ALUMINUM CAP.
SET 20d NAIL W/PLASTIC TAG IN THE NORTH SIDE OF A 10" OAK S58°E 37.84'
SET 20d NAIL W/PLASTIC TAG IN THE NORTHEAST SIDE OF A 24" OAK S01°W 20.35'
SET 20d NAIL W/PLASTIC TAG IN THE NORTHEAST SIDE OF AN 8" OAK S43°W 30.55'
SET 20d NAIL W/PLASTIC TAG IN THE NORTH SIDE OF AN 8" OAK S70°W 70.16'
CORNER LIES ON FENCE LINE TO THE SOUTH
CORNER LIES 6' ± NORTH OF EAST-WEST GRAVEL CENTERLINE
H-13, T2N, R8W, BALTIMORE TOWNSHIP LIES WEST 30.69'

ACT 305 BARRY COUNTY REMONUMENTATION
APPROVED BY PEER REVIEW AT A MEETING HELD ON

8 Nov '99
BRIAN REYNOLDS

BC
COUNTY SURVEYOR

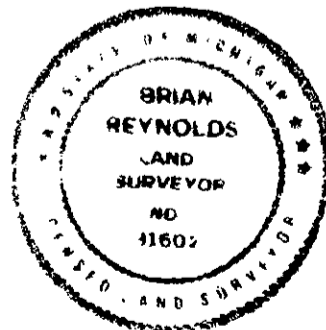

Signed by Brian Reynolds
Surveyor's Michigan License No 31602

Date Dec 3, 1999