

FEB 03 1999

BARRY COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For Corners in
BARRY
(county)

Located In:

Corner Code #

1. Public Land Survey
CORNER COMMON TO
SECTIONS 19, 20, 29 & 30
BALTIMORE TOWNSHIP

T 2N R 8W
T _____ R _____
T _____ R _____
T _____ R _____

C-9



2737

Page: 1 of 1
12/17/1998 12:35P

Sandy Schandelmayer - Barry Co. LCRCR

Register of Deeds Stamp & File Number

2. Property Controlling
in Section

S _____ T _____ R _____
S _____ T _____ R _____

3. Miscellaneous

S _____ T _____ R _____

4. Lot No _____, Recorded Plat _____

5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Brian Reynolds, in a field survey on 13 JULY, 1998 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. GENERAL LAND OFFICE: MUSGROVE EVANS, D.S., 1826 (R8W, P.80) A Be. 6 S56½E 41 MAPLE 22 S80W 31

*** NO OTHER HISTORICAL INFORMATION, PUBLIC OR PRIVATE, AVAILABLE FOR THIS CORNER ***

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

APPARENT CORNER POSITION LIES IN A 7'- 8' ROAD CUT AREA. FOUND NO MAGNETIC EVIDENCE OF CORNER MONUMENTATION.
REESTABLISHED CORNER POSITIONS FOR C-8 AND C-10 (SEE CORNER RECORDING FORMS FOR THOSE CORNERS).
ESTABLISHED POSITION FOR C-9 AT MID-POINT BETWEEN RESTORED C-8 AND RESTORED C-10, AND IN LINE WITH FENCE OCCUPATION LINES NORTH AND SOUTH.

SET STANDARD BARRY COUNTY REMONUMENTATION MONUMENT.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET STANDARD BARRY COUNTY REMONUMENTATION MONUMENT (3/4" X 36" IRON) WITH ALUMINUM CAP.
SET 20d NAIL W/PLASTIC TAG IN THE EAST SIDE OF A WOOD FENCE CORNER POST S2°W 9.49'
SET 20d NAIL W/PLASTIC TAG IN THE NORTHWEST SIDE OF A 12" POPLAR S8°W 6.00'
SET 20d NAIL W/PLASTIC TAG IN THE SOUTHWEST SIDE OF A 10" POPLAR S12°E 3.76'
SET 20d NAIL W/PLASTIC TAG IN THE NORTH SIDE OF A 5" TWIN MAPLE N82°W 9.67'
CORNER LIES 27' +/- SOUTH OF EAST-WEST GRAVEL CENTERLINE
SET ½" CAPPED IRON (REYNOLDS #31602) NORTH 60.04'
SET 60d SPIKE NORTH 27.04' ON CENTERLINE OF GRAVEL ROAD

ACT 345 BARRY COUNTY REMONUMENTATION
APPROVED BY PEER REVIEW AT A MEETING HELD ON

13 July '98
BRIAN REYNOLDS

BR
COUNTY SURVEYOR

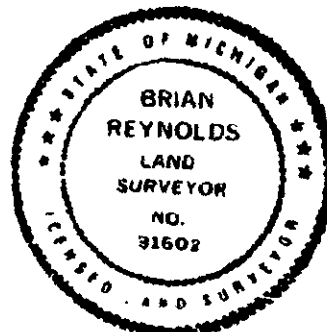

Signed by _____
Surveyor's Michigan License No 31602

Date DEC 15, 1998