

BARRY COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SURVEY & REMONUMENTATION

APR 04 2000

SECTION

For Corners in BARRY (county)
Located In: _____ Corner Code # _____

1. Public Land Survey T 2N R 8W H-13
SOUTH 1/4 CORNER
SECTION 34
BALTIMORE TOWNSHIP
ON TOWNSHIP LINE

2. Property Controlling in Section S ___ T ___ R ___
S ___ T ___ R ___

3. Miscellaneous S ___ T ___ R ___

4. Lot No _____, Recorded Plat _____
5. Private Claims _____



2817
Page: 1 of 1
12/07/1999 09:36

Darla K. Burghdoff - Barry Co. LCRCR

Register of Deeds Stamp & File Number

I, Brian Reynolds, in a field survey on 8 NOVEMBER, 1999 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

- A. Description of original monument and accessories and/or subsequent restoration:
- GENERAL LAND OFFICE: JOHN MULLETT, D.S., 1826 (R8W, P. 49) BEECH 12 N30E 50 W. ASH 6 N29W 12
 - COUNTY SURVEYOR LEE S. COBB, APRIL 1, 1910, L. 1, P. 371, SURVEY OF NE 1/4 SECTION 34, "THENCE RAN TRANSIT LINE SOUTH, SET TEMP INT. 1/4 SEC. COR. INTERSECTED TOWN LINE 56 LKS. WEST, STONE FOR CORNER"

*** NO OTHER HISTORICAL INFORMATION, PUBLIC OR PRIVATE, AVAILABLE FOR THIS CORNER ***

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND NO MAGNETIC EVIDENCE OF CORNER MONUMENTATION. FOUND WELL POINT FOR THE STANDARD CORNER AT G-13, T2N, R8W, BALTIMORE TOWNSHIP. TRAVERSED THE NORTH LINE OF SECTION 3 AND FOUND NO MONUMENTATION AT H-13 OR H-1 (T1N, R8W). FOUND IRONS BY KING REPRESENTING I-13 & I-1 (T1N, R8W) AS RECITED IN L.C.R.C. #123, FOUND MONUMENTS AT I-13 & I-1, P.S. #14766. TRAVERSED THE TOWN LINE FURTHER EAST TO I-13, FOUND AN IRON SET BY KING IN REFERENCE TO AN ORIGINAL GLO WITNESS. BASED ON REVIEW OF MEASUREMENTS AND OCCUPATION LINES, DISREGARDED FOUND MONUMENTS AT I-13 & I-1 BY KING. RESTORED I-13 AT LOCATION THAT BEST FIT ALL MEASUREMENTS AND OCCUPATION. RESTORED H-13 AT MID-POINT ON LINE BETWEEN G-13 AND I-13. SET STANDARD BARRY COUNTY REMONUMENTATION MONUMENT AND CAP.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET STANDARD BARRY COUNTY REMONUMENTATION MONUMENT (3/4" X 36" IRON) WITH ALUMINUM CAP.
SET 20d NAIL WIREMON TAG IN THE NORTH SIDE OF AN 8" OAK S57°W 43.10'
SET 20d NAIL WIREMON TAG IN THE NORTHEAST SIDE OF AN 8" OAK S25°E 23.83'
SET 20d NAIL WIREMON TAG IN THE NORTHEAST SIDE OF A 24" OAK S57°E 37.03'
SET 20d NAIL WIREMON TAG IN THE NORTH SIDE OF A 10" OAK S73°E 66.05'
CORNER LIES 6'± NORTH OF EAST-WEST GRAVEL CENTERLINE
H-1, T1N, R8W, JOHNSTOWN TOWNSHIP LIES EAST 30.69'
CORNER LIES 30'± WEST OF FENCE LINE RUNNING TO THE SOUTH

ACT 345 BARRY COUNTY REMONUMENTATION
APPROVED BY PEER REVIEW AT A MEETING HELD ON

8 Nov. 99
BRIAN REYNOLDS

BR
COUNTY SURVEYOR

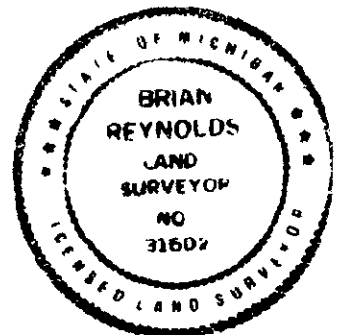

Signed by

Brian Reynolds

Date

DEC 3, 1999