

SURVEY & REMONUMENTATION

NOV 04 1996

COMMISSION

BARRY COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN
COUNTY OF BARRY
RECEIVED FOR RECORD

AUG 20 11 27 AM '96

Sandy Schindelmarjer
REGISTER OF DEEDS

002399

Register of Deeds Stamp & File Number

For corners in

BARRY

(County)

Located In:

Corner Code #

1. Public Land Survey	T	<u>3N</u>	R	<u>9W</u>	<u>J-1</u>
NORTH 1/4 CORNER OF	T	_____	R	_____	_____
SECTION 2 RUTLAND TOWNSHIP	T	_____	R	_____	_____
ON TOWNSHIP LINE	T	_____	R	_____	_____
2. Property Controlling	S	_____	T	_____	_____
in Section	S	_____	T	_____	_____
3. Miscellaneous	S	_____	T	_____	_____
Property in Sec.	S	_____	T	_____	_____

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, **BRIAN REYNOLDS**, in a field survey on **31 MARCH**, 19**95**

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration

CORNER NOT SET BY GENERAL LAND OFFICE

COUNTY ROAD COMMISSION: Y.M.C.A. ROAD (F.B.,P.4) "FOUND IRON"

32" OAK S2°W 55.1' P. POLE S60°E 78.4'

RD. SIGN POST N45°E 24.5' STONE E. 4.55'

LAND CORNER RECORDATION CERTIFICATE: #364, BY PAUL E. VAN KOOTEN, P.S.#8618

"FOUND 1 1/4" IRON ON CENTERLINE OF WOODRUFF ROAD, RAISED WITH 3/4" SOLID IRON"

PK IN E'LY SIDE T. POLE N-NW 47.39' TOP CENTER TELE. PEDESTAL E-NE 65.73'

PK IN N'LY SIDE P. POLE E-SE 79.00' PK IN W'LY SIDE T. POLE SE 92.18'

CL BUEHLER ROAD TO NORTH E 21.00' CL BUEHLER ROAD TO SOUTH E. 28.00'

ACT 132 SURVEY (L.1,P.774) BY P. E. VAN KOOTEN, P.S.#8618 "3/4 SOLID ROD" WITNESSES SAME AS LCRC#364


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 3/4" IRON ROD AS PER VAN KOOTEN'S WITNESSES ON LCRC#364.

MEASUREMENTS ALONG TOWNSHIP LINE 1 1/2 MILES EAST AND WEST CONFIRM POSITION OF FOUND IRON.

ACCEPTED FOUND IRON AS BEST EVIDENCE OF CORNER POSITION.

REPLACED 3/4" IRON WITH STANDARD BARRY COUNTY REMONUMENTATION MONUMENT.

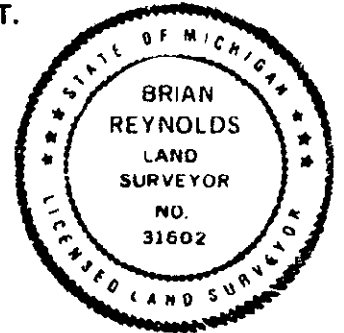

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET STANDARD BARRY COUNTY REMONUMENTATION MONUMENT (3/4"X36"W/ALUMINUM CAP)

FOUND "PK" IN THE EAST SIDE OF A UTILITY POLE N3°W 47.39'

FOUND "PK" IN THE NORTH SIDE OF A UTILITY POLE S70°E 79.00'

FOUND "PK" IN THE WEST SIDE OF A UTILITY POLE S20°E 92.18'

SET 40d NAIL W/PLASTIC TAG IN THE EAST SIDE OF A 10" TWIN OAK SOUTH 50.11

CENTERLINE OF BUEHLER ROAD TO NORTH EAST 21'+/-

CENTERLINE OF BUEHLER ROAD TO SOUTH EAST 28'+/-

J-13 T4N, R9W, IRVING TOWNSHIP EAST 4.42'

ACT 345 BARRY COUNTY REMONUMENTATION
APPROVED BY PEER REVIEW AT A MEETING HELD ON

JULY 10, 1995 BR
BRIAN REYNOLDS COUNTY SURVEYOR

Signed by [Signature]

Date AUGUST 16, 1996

Surveyor's Michigan License No. 31602