

JAN 1 1999

BAY COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Form with fields for BAY COUNTY (County), Located In, Corner Code #, and numbered sections 1-3 for Public Land Survey, Property Controlling in Section, and Miscellaneous Property in Sec.

Vertical stamp: REGISTER OF DEEDS BAY COUNTY, MICHIGAN

Vertical stamp: 1999 JAN - 5 A 9: 08

Vertical stamp: RECORDED

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

Grid table with columns A-L and rows 1-13, containing numbers 1-36.

I, DALE L. WINIECKE, in a field survey on NOVEMBER 9, 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same Town and Range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

L-11
POST SET BY, J. MULLETT, D.S. MAY 30 1846
12" HEMLOCK, N 45°E 29 LINKS
10" HEMLOCK, S 30°W 12 LINKS

COUNTY SURVEYOR NOTES-SECTION 25- G. TURNER-1910 ±, T18N, R3E- STAKE SET BY FORMER COUNTY SURVEYOR
COUNTY SURVEYOR NOTES-SECTION 36- G. TURNER-1910 ±, T18N, R3E- STAKE SET BY FORMER COUNTY SURVEYOR


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

L-11
SEARCHED THE APPARENT LOCATION OF THE CORNER AND FOUND NO EVIDENCE OF THE CORNER. RE-ESTABLISHED THE CORNER USING THE PRORATED DISTANCES BETWEEN M-11 AND K-11 TO ESTABLISH THE EAST-WEST POSITION. THE NORTH-SOUTH POSITION WAS RE-ESTABLISHED FROM THE AVERAGE OF THE PRORATED DISTANCES BETWEEN K-10 & K-11 AND M-10 & M-11 FOR THE COUNTY SURVEYORS NOTES FROM SECTION 25, T18N, R3E.
THE RE-ESTABLISHED CORNER WAS ACCEPTED AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-11
SET 5/8" x 24" REROD WITH BAY COUNTY REMONUMENTATION CAP IN MONUMENT BOX.
N 5°W 29.80' SET NAIL AND TAG IN EAST FACE OF RAILROAD TIE FENCE POST.
N 20°E 72.65' SET NAIL AND TAG IN WEST FACE OF 8" ELM.
S 45°E 72.48' SET NAIL AND TAG IN EAST FACE 6" BOX ELDER
S 10°W 61.53' SET NAIL AND TAG IN EAST FACE OF POWERPOLE
S 45°W 40.05' SET 1/2" REROD WITH PS CAP # 41915
SOUTH 2.5' TO PHYSICAL CENTERLINE OF SAGANING ROAD
NORTH 9.2' TO NORTH EDGE OF ASPHALT ROAD

APPROVED LAND CORNER
P.A. 74 OF 1970 - Bay County
DEC 9 DEC 98
MTM
Michael MacDonald P.S.
County Representative

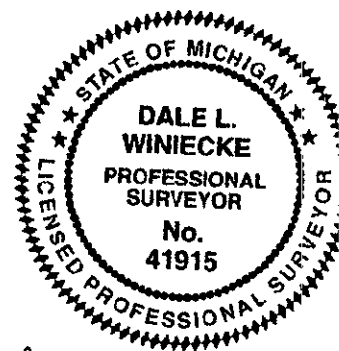

Signed by Dale Winiecke
Surveyor's Michigan License No. 41915

Date 12/30/98