

RATIFIED BY THE BERRIEN COUNTY
SURVEY PEER GROUP AS THE
OFFICIAL CORNER UNDER MICHIGAN
PUBLIC ACT 345 OF 1990

RECORDED

**Berrien County Remonumentation Program
LAND CORNER RECORDATION CERTIFICATE**

00 NOV -8 PM 12: 51

SERVICE TRETHERWAY
REGISTER OF DEEDS
BERRIEN COUNTY, MICHIGAN

11/08/00 111#6048 A66
CORNER \$7.00
11/08/00 111#6048 A66
STATE REMON FEE \$2.00

Register of Deeds Stamp & File
Number

for corners in

Berrien (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>4S</u> R <u>17W</u>	<u>B-13</u>
	T ___ R ___	___
	T ___ R ___	___
	T ___ R ___	___
2. Property Controlling in Section	S ___ T ___ R ___	___
	S ___ T ___ R ___	___
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	___
	S ___ T ___ R ___	___

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Alan K. Bartlett, in a field survey on March 29, 2000
do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the
corner points mentioned in lines 1 and 2 above were in conformance with
regulations and rules therefore as required in the current manual of survey
instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and /or that the corner points
mentioned in lines 3, 4 and 5 above were in conformance with the rules of the
Michigan Board of Land Surveyors or by a Decree of a Court of Law;
established, re-established, monumented, recovered, found as expressed
below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	16		17		18		19		20		21		22
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded
on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

GLO- WM. BROOKFIELD; WEST ON SOUTH SIDE OF SECTION 31, 40.00 CHAINS TO 1/2 MILE
POST. WITNESSES: N74.5°E 22 LINKS 7" W. ASH, N32.75°W 15 LINKS 9" ELM
1875- THOMAS LOVE, COUNTY SURVEYOR; BEARINGS TO THIS CORNER GONE, OLD STUMP FOUND TO AGREE WITH STAK STANDING. NEW
BEARINGS: N53°E 12 LINKS 8" BEECH, N19°W 25 LINKS 6" BEECH
Unknown ALTON HOWARD: 1/2 MILE DISTANCE WEST (TO A-13) =2644.31' (SEE C-13), 1/2 MILE DISTANCE EAST (TO C-13) =2624.21', 8.91' JOG
WEST TO B-1 (N 1/4 SEC 6-T5S-R17W)


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

POOR HISTORY ON CORNER. ONLY WITNESSED BY B-1 N1/4 SECTION 6. USED JOG DISTANCE OF 8.91' FROM PREVIOUS SURVEY TO
REESTABLISH.
THIS METHOD AND POSITION APPROVED BY THE BERRIEN COUNTY REMONUMENTATION PEER GROUP OF SURVEYORS

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET CONCRET MONUMENT WITH BERRIEN COUNTY BRASS CAP (MARKED 2000 & 35988). THIS CORNER IS ACCEPTED AS A CAREFUL AND FAITHFUL
REESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER.

Witnesses: N22°E 34.16' 20" POPLAR
S55°E 18.44' 12" ASH
S30°W 17.58' 8" ASH
S55°W 25.98' 20" ASH
WEST 8.91' B-1 N 1/4 SEC. 6 - REMONUMENTED
WEST 37.60' 12" ASH

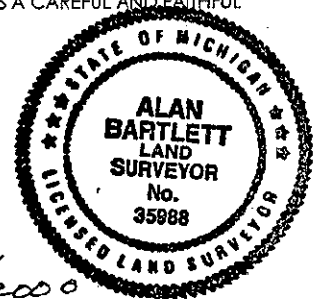

Signed by Alan K. Bartlett

Date 11/02/2000

Surveyor's Michigan License No. 35988

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995

**SURVEY &
REMONUMENTATION**

JAN 31 2001

LIBER 4 PAGE 240

SECTION