

MAR 9 1999

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

Chippewa County Remonumentation Corner #7.00 LAND CORNER

For corners in SECTION

Chippewa County	Located in:	Corner Code #
1. Public Land Survey	T44N R2W	D-9
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. , Recorded Plat		
5. Private Claims		

\$2.00 MSSR

5 MAR 1999 1:55:03 PM Receipt #14029

RECEIVED FOR RECORD
CHIPPewa COUNTY - STATE OF MICHIGAN
SHARON H. KENNEDY, REGISTER OF DEEDS

BOOK 11 PAGE 6

Register of Deeds Stamp & File Number

I, Keith R. Waters, in a field survey on January 20, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

D-9 1/4 Corner Common to Sections 20 & 29, T44N, R2W

1845 - Original corner established by James Mullett.

Witnesses: Fir 10, N48°E 15 links - Fir 8, S44°W 23 links.

1897 - Chippewa County Surveyor Frederick H. Brown, RLS 944. Sketch of Section 20 shows a distance of 5163 feet on the south line of said section, no mention is made of the 1/4 corner. Brown notes that the southwest corner is considerably east of the original corner location.

1959 - Liber 2, page 252, Chippewa County corner records. Michigan State Highway Department surveyor Ray Walker, found wooden post, replaced with boat spike. Witnesses:

Fence Post, S23°E 29.28' - Power Pole, N65°W 74.40' - Fence Post, S25°W 29.84'

1987 - LCRC, liber 7, page 101, Chippewa County corner records. Larry R. Rogers, P.S. 29251, found no evidence of the Highway Department corner. Reestablished corner on line between section corners at C-9 and E-9, on the extension of a fence line to the north. Set a 1/2" iron w/cap #29251. Witnesses:

Northeast corner of Concrete Headwall, S68°W 87.70'

Northeast corner of Concrete Headwall, N70°W 71.04'

3" Apple tree, N16°E 68.02'

Power Pole, S30°W 71.12'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

Found a 1/2" iron with cap #29251 and all witness objects as called for in the above mentioned 1987 LCRC.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Found a 1/2" iron with cap #29251 at the corner location, which falls 2.4 feet north of the centerline of Highway M-48.
Witnesses:


Northeast corner of Concrete Headwall, S68°W 87.70'

Northeast corner of Concrete Headwall, N70°W 71.04'

Nail and plastic witness tag #33142 in west side of Multi-stemmed Apple, N16°E 67.77'

Nail and plastic witness tag #33142 in east side of Power Pole, S30°W 71.10'

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

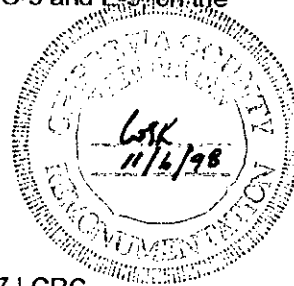

Signed by Keith R. Waters

Date 12-30-98

Surveyor's Michigan License No. 33142