

SURVEY & REMONUMENTATION

SEP 18 1997

COMMISSION

Approved By Delta County
Land Survey Remonumentation
Peer Group Under Act 345 Of
P.A. Of 1990 On July 23, 1997
Robert Schumling
Chairman

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corner DELTA

DELTA
(County)

Located In:

Corner Code #

- | | | |
|------------------------------------|-------------|-------------|
| 1. Public Land Survey | T40 N R23 W | A-01 & B-01 |
| | T40 N R24 W | M-01 |
| | T R | |
| | T R | |
| 2. Property Controlling in Section | S T R | |
| | S T R | |
| 3. Miscellaneous Property in Sec. | S T R | |
| | S T R | |

Recorded 28 July 1997
at 9:00 o'clock a.m.
Liber 8 Page 205
Walter C. Thorne
Delta County, Ill. Reg. of Deeds

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____
A-01 [NW COR SEC 6] B-01 [N1/4 COR SEC 6]
M-01 SAME CORNER AS A-01


A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, M.P. DAVIS, in a field survey on JUNE, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the cornerpoints mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
A-01 [NW COR SEC 6] JOHN BURT, D.S. - 1846 (FIR 6"-S06°W-23 LINKS) (TAMERAC 10"-S75°W-15 LINKS) (W. PINE 10"-S18°E-18 LINKS) 1946 RECORDS OF M.S. McNABB INDICATE COR IN PLACE 66' WEST OF SE COR OF SEC 32 T41N R23W, NO DESCRIP. ON MON GIVEN OR BT'S NOTED.
B-01 [N1/4 COR SEC 6] WOOD POST - NOT SET IN ORIGINALS
M.S. McNABB - 1946 - ID BY IRON BOLT IN PLACE, 713' WEST OF S1/4 COR SEC 33 T41N R23W-NBT'S ELM 5" S20°E 27.5' ELM 8" N73°E 16.8'

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
A-01 [NW COR SEC 6] NO CORNER EVIDENCE FOUND. AS PER THE RECORDS OF M.S. McNABB RESET CORNER 66.0' WEST OF THE SE COR OF SEC 32 T41N R23W & ON LINE WITH SAID SE COR & THE S1/4 COR OF SAID SEC 32. ACCEPTED AS BEING THE BEST AVAILABLE EVIDENCE AS TO THE LOCATION OF THE POSITION OF THE ORIGINAL CORNER.
B-01 [N1/4 COR SEC 6] UNABLE TO LOCATE IRON BOLT MENTIONED IN McNABB'S NOTES. ID CORNER POSITION BY BOTH OF McNABB'S ELM BTS (NOW DOWN & BADLY DETERIORATED). CORNER POSITION FALLS ON 4TH CORRECTION LINE & 713' WEST OF THE S1/4 COR OF SEC 33 T41N R23W.

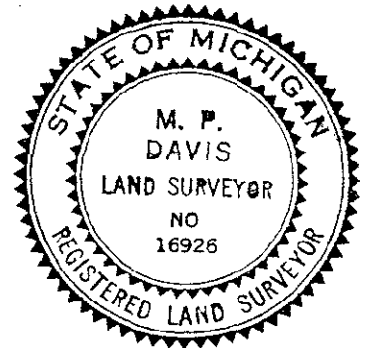

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
A-01 SET A 5/8" X 18" REBAR W/A 3 1/4" ALUM CAP STAMPED TO ID THE CORNER POSITION
W. PINE 09" N20°W 9.22'
W. PINE 09" N50°E 28.34'
SPRUCE 06" S89°W 25.23'
SPRUCE 7" S46°E 10.39'
SE COR SEC 32 T41N R23W EAST 66.0'
B-01 SET A 5/8" X 18" REBAR W/A 3 1/4" ALUM CAP STAMPED TO ID THE CORNER POSITION
SPRUCE 7" S84°W 28.62'
ELM 06" S08°E 11.11'
S1/4 COR SEC 33 T41N R23W WEST 713.0'

NOTE: BEARINGS TO REFERENCE OBJECTS ARE MAGNETIC-DISTANCES ARE TO A BOLT W/A REFERENCE TAG, UNLESS OTHERWISE NOTED.

Signed by M.P. Davis Date 7/23/97

Surveyor's Michigan License No. 16926