

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Dickinson
 (County)

Located In: Corner Code #

1. Public Land Survey

T 41N R 29W F8
 T _____ R _____
 T _____ R _____
 T _____ R _____

2. Property Controlling in Section

S 21 T 41N R 29W 5
 S _____ T _____ R _____
 S _____ T _____ R _____
 S _____ T _____ R _____

3. Miscellaneous Property in Sec.

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Apr 26 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


Register of Deeds Stamp & File Number

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		●		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:
 (F8) Center of Section 21. Corner not established in the original survey.
 (5-Sec. 21) North 1/16 corner, Section 21. Corner not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 (F8) Established the corner at the intersection of straight lines connecting opposite Quarter corners. The Quarter corner between Sections 21 & 28 was taken at the midpoint of the mile and falls, unmonumented, in Lost Lake.
 (5-Sec. 21) Established the corner on a straight line between Quarter corner 1325.68' north and Center of Section 1325.68' south.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 (F8) Set 1" 10x32" iron pipe with 4 alum. MDNR cap. Blazed and scribed:
 4" Sugar N14E 16.4' "1/4 BT"
 14" Y. Birch S34E 15.5' do
 9" Sugar S74W 13.9' do
 7" Sugar N50W 24.4' do
 Set sq'd cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.
 (5) Set 1" 10x32" iron pipe with 4 alum. MDNR cap. Blazed and scribed:
 16" Cedar S65E 8.8' "1/16S BT"
 9" Cedar S42W 28.6' do
 12" Cedar N58W 27.8' do
 12" Cedar N4W 24.4' do
 Set sq'd cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

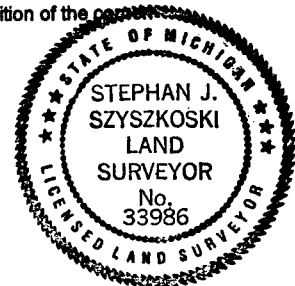

Signed by Stephan J. Szyszkoski Date 5/23/01
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division