For corners in SECTION
ONTONAGON
GOGEBIC (County)
1. Public Land Survey
Property Controlling in Section Miscellaneous Property in Sec.
4. Lot No, Record

MAR 0 2 2000

Filing Requirement of Act 74, Mich. P.A. 1970

Corner Code #

C - 13

LAND CORNER RECORDATION CERTIFICATE

Seg. 2	
	
	

Regarder's diffice Engebic County ss.

Ramona

Received for record the 10 TH GRY OF NOVEMBER A. D. 19 99 at 11:25 o'clock Am., and recorded is Of CORNELS Liber___ 63 page 270 Cours Deputy

Register of Deeds Stamp & File Number

Register of Deads

4. Lot No , 5. Private Claims _	Recorded Plat
	<u> </u>

Located In:

Section Corner common to Sections 31 & 32, T48N R41W and


Sections 5 & 6, T47N R41W.

I. <u>Farl W. Applekamp</u>, in a field survey on <u>Sept. 29</u>, 19 <u>99</u> do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with requirements and rules therefore the property of the corner points are rules to the corner points. conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

T48NR 41W

T47NR41W

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

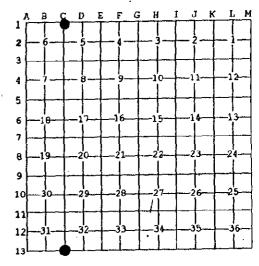

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by William A. Burt, U.S. Deputy Surveyor, 1847. Set Cedar Post.

ORIGINAL BEARING TREES:

16" N59°E Hemlock 24" N67°W Tamarack

39 Links (25.74 feet) 40 Links (26.40 feet) PREE CEOUP APPRICE

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No original evidence was found. A 4"X4" yellow tag on an aspen indicating approximate corner 15 feet South. This position is East about 30 feet from the position I ultimately set the corner. I re-established the corner by single proportionate measure and on the Town line between the monumented SW Corner of Section 31 and the St Corner of Section 32. These two corners had been monumented from original bearing trees in 1961 & 1970 respectively. This position is consistent with a GLO call of "79 Chains Enter Swamp."

Research on file with the Ontonagon County Remonumentation Program Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner

At the corner position I set a $2\frac{1}{2}$ "X30" split base aluminum pipe with a 3" cap stamped to read: County Remonumentation, T48N T47N R41W, S31, S32, S5, S6, P.S. 17610. I established three bearing trees and a reference object.

- Nail in 5" Balsam S31°E 33.301 s36°W 33.351 Nail in 4" Balsam 31.35' - 6' Steel Sign Post North N87°E Nail in 6" Aspen

THE WALL	EARL W. APPLEKAMP PROFESSIONAL SURVEYOR NO. 17610	HATTER TO THE TANKE OF THE PARTY OF THE PART
ALAN	POFESSIONE.	A RESTA

Signed by Lail W	applekamp	
Surveyor's Michigan License No.	, ,	17610

October 1, 1999 Date

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14,1975 REVISED JAN, 1983 REVISED OCT., 1995