

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Houghton
 (County)

Located In:

Corner Code #

- | | | |
|------------------------------------|----------------|-------|
| 1. Public Land Survey | T52N R 36W | J9 |
| | T___ R___ | _____ |
| | T___ R___ | _____ |
| | T___ R___ | _____ |
| 2. Property Controlling in Section | S___ T___ R___ | _____ |
| | S___ T___ R___ | _____ |
| 3. Miscellaneous Property in Sec. | S___ T___ R___ | _____ |
| | S___ T___ R___ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

May 21 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19__ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		10		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9										●			
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

Quarter corner common to Sections 23-26. Corner established in 1846 by Sylvester Higgins: "East Random between Sections 23&26, 7.00 Enter low wet lands NE & SW, 12.38 Leave do, 79.99 Intersected 36 L N of post. West Corrected between Sec 23 & 26, 9.92 Sugar 16, 28.12 Y. Birch 8, 40.00 Set 1/4 Sec. post, Sugar 14 N80W 5, do 12 S70E 35, 52.10 Sugar 14, 67.62 Cedar 12, 79.99 Sec. corner". Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


The original post and accessories were not recovered. Found no monumentation at the corner position. Recovered the remains of a cedar possible line tree, a burned out hollow cedar, at the swamp edge, in accord with the record, monumented and recorded elsewhere this date, west 28.2653 ch., a reestablished corner west 40.7077 ch., and a remonumented corner 41.3632 ch. east. To reestablish J9, I produced the line between I9 and the line tree and placed the corner on this line at the longitude proportionate to the original record between the line tree and K9. The true bearing and distance to adjacent section corners was found: N89deg 21'58"W, 40.7077 ch. and N81deg 43'13"E 41.3632 ch. At this position I find a very old hollow stub 34" Sugar S31W 32.9' with many scars facing in the direction of this corner, and a 20" Oak N02E 10.5' with lower blaze and possible upper blaze overgrown facing in the direction of the corner. Position is corroborated somewhat by the location of monumented J8. The pipe at J8 was found only 5' Westerly of a straight line from J9 (herein recorded) to the monumented and recorded J7. At the position for the corner I placed a 1" ID x32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 1" pipe with 4" MDNR cap. Blazed and scribed the following:

- 14" Sugar S63W 11.60' "1/4S NBT"
- 11" Y. Birch N42W 3.75' do
- 12" Sugar S79E 28.30' do
- 10" Sugar S16W 21.60' do

Placed a squared ironwood post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

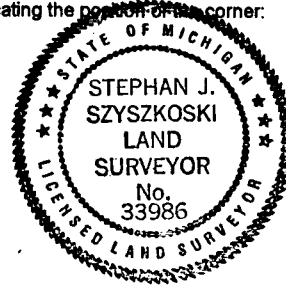

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 4-6-99

For the Michigan Department of Natural Resources - Forest Management Division