

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Huron</u> <small>(County)</small>	Located In:	Corner Code: //
1. Public Land Survey	T <u>15</u> N R <u>14</u> E	F-1
	T <u>15</u> N R <u>14</u> E	G-1
	T <u>15</u> N R <u>14</u> E	G-2
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

Register of Deeds Stamp & File Number

I, Donald L. Bissell, in a field survey on January, 19 89, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1	1	1	1	1	1	1	1
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

F-1	G-1	G-2
N $\frac{1}{4}$ Cor. Sec. 4, T15N, R14E	NE Cor. Sec. 4, T15N, R14E	E $\frac{1}{4}$ Cor. Sec. 4, T15N, R14E
Set $\frac{1}{2}$ " re-rod on line with S $\frac{1}{4}$ cor. to the SW cor. Sec. 33, T16N, R14E at equal distance from the NE cor. and the	Set $\frac{1}{2}$ " re-rod at G.L.O. distance	Fd. $\frac{1}{2}$ " iron rod in road

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-1	G-1	G-2
NW cor. Sec. 4.	N49°E - 94.45' - Power Pole	N83°W - 33.00' - Conc. mon.
N21°E - 170.09' - 12" Elm	N77°E - 91.48' - Power Pole	N38°W - 96.39' - 12" R. Pine
S52°E - 39.0' - S end of westerly 18" C.M.P.	S32°W - 85.93' - Power Pole	N64°W - 38.36' - Power Line
S85°E - 28.78' - Angle iron, S $\frac{1}{4}$ cor. Sec. 33		31' South of drive centerline In line with ditch to East

Signed by Donald L. Bissell Date _____
 Surveyor's Michigan License No. 18655

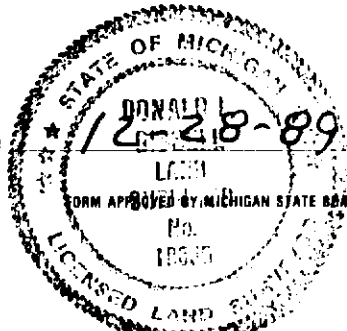

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983