

(71)

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Iron

(County)	Located in:	Corner Code #
1. Public Land Survey	T <u>42N</u> R <u>31W</u>	E9
	T <u>42N</u> R <u>31W</u>	E8
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Aug 07 1996

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:


(E9) Corner common to Sections 20-21-28-29. Corner established in 1849 by John Burt: "80.00 Set Y. birch post cor of Sects. 20,21,28,29. Heal 26 S36E 7, do 14 N69W 40". Records of Wisconsin Michigan Power Company (now Wisconsin Electric Power Company) in the form of a map titled PROPERTY MARKERS PAINT AND MICHIGAN RIVERS map #G-210-GG dated 4/10/1947 show in regard to this corner: "Both B.T.s for M.C. on river bank dist. checked to south and east. Conc. marker set 275' west of 20-21-28-29. 4' poplar S54W 9.9', 4' poplar N74E 11.9', 7' poplar N53W 24.7". Found no subsequent record.
(E8) Quarter corner common to Sections 20-21. Corner established in 1849 by John Burt: "40.00 Set W. Pine qr Sect post. Y. Pine 14 N17W 23, do 14 S26E 30". Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(E9) Original post and accessories presumed lost beneath the surface of Peavy Pond. Found the concrete marker noted above. It is a 7" truncated right rectangular pyramid with a 3" square brass capped affixed on top which is stamped: "Wisconsin Michigan Power Company 42-31 20-21-28-29 275 ft E. to cor". The witnesses were not recovered. The monument projects 3" at the base of an 11" W. Spruce. I accepted the monument as a reference to the original corner and reestablished the corner due east (astronomic or true east) 275.00' from the monument. The corner falls in Peavy Pond and was not monumented. It's position was used to reestablished the 1/4 corners on the south and east sides of Section 20. Witnesses below are to the reference monument.
(E8) Original post and accessories not recovered. Found no evidence of the position of the original corner on the ground. There are a few old, burnt, small, Y. Pine stumps in the area but none will fit the record. Reestablished the corner on a straight line between Section corners 2620.76' north and south. At the position for the corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(E9) Witnesses to the WHPCO concrete reference monument: Blazed and scribed the following bearing trees:
9" db1 Maple S73W 41.0' "RM BT"
9" Maple clump N40W 25.3' "RM BT"
9" triple Maple N28E 36.6' "RM BT"
10" W. Spruce S13W 0.5' "RM BT"
Shore of Peavy Pond is East 21', course N50E. Bearings are magnetic.
(E8) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following new bearing trees:
5" Sugar N56E 6.3' "1/4S NBT"
8" Maple S15E 14.0' "1/4S NBT"
9" Maple S73W 12.2' "1/4S NBT"
8" Maple N41W 19.3' "1/4S NBT"
Placed a 4" squared maple post adjacent. Bearings are magnetic.

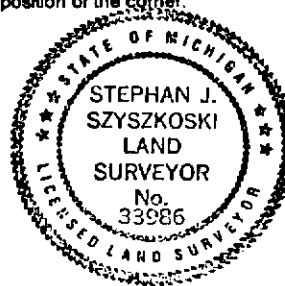

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 9-9-96

For the Michigan Department of Natural Resources - Forest Management Division