

SURVEY & REMONUMENTATION

JAN 19 1999

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>42N</u> R <u>34W</u>	<u>B-3</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

IRON COUNTY
MICHIGAN
RECEIVED FOR RECORD

98 DEC 28 AM 11:29
L.C. Record: L. 7, P. 337

Gilbert J. Pisoni
REGISTERED LAND SURVEYOR

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Quarter Corner Sections 6 and 7, T42N, R34W

I, Gary L. Pisoni, in a field survey on Dec. 16, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3		●											
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established on October 12, 1851 by Guy H. Carleton, U.S. Deputy Surveyor.
 Original Corner; Wood Post
 Original Bearing Trees:

Fir	10"	N 10° E	60 links (39.60 feet)
Lynn	18"	S 25° W	90 links (59.40 feet)

In 1977, Ewart C. Muller RLS found an iron pin inside a monument box marking the SW corner of the Plat of Gaastra which is also the Quarter corner between Sections 6 and 7, recorded in L.C. Certificate Liber 1, Page 451 on 3/17/77.

In 1978, Gary L. Pisoni RLS found an iron bar located in a monument box in the centerline of County Road 424 and a county road which runs North. Iron bar is the SW corner of the Plat of Gaastra.

PEER GROUP APPROVED

Iron A. Pisoni 12-18-98
 COUNTY REPRESENTATIVE

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original B.T.s found. After the repaving of County Road 424, I set a P.K. nail in the asphalt over the top of the corner position. I accept the iron bar in monument box as the best available evidence for restoring the corner position.

Corner record research on file with County Representative.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

From the above described corner position, I set a reference monument, being a 5/8" diameter by 30" long rebar with a 3" aluminum cap stamped as follows:
 Iron County Remonumentation, T42N, R34W, R.M., 1/4, S-6, S-7, N 44° W, 34.73', 1998, RLS 27457, from which I established the following new bearing objects:

Utility Pole #8-83	S 54° W	40.40 feet
Utility Pole w/transformer	N 60° W	59.14 feet
Utility Pole	N 35° E	42.66 feet
Utility Pole #3B3	S 48° E	33.14 feet
R.M. 5/8" x 30" rebar	S 44° E	34.73 feet
Steel sign post	S 44° E	35.28 feet

98-165
 Signed by *Gary L. Pisoni* Date 12-21-98
 Surveyor's Michigan License No. 27457

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983
 REVISED OCT., 1995

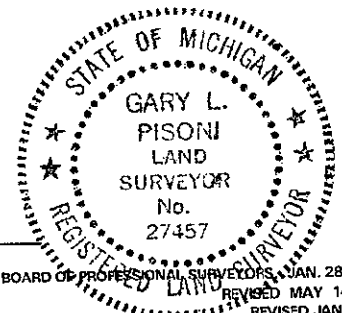

L. 7 P. 337