


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

<u>Iron</u> <small>(County)</small>	Located In:	Corner Code #	
1. Public Land Survey	T _____ R _____	_____	
	T _____ R _____	_____	
	T _____ R _____	_____	
	S <u>18</u> T <u>43N</u> R <u>33W</u>	<u>15</u>	
2. Property Controlling in Section	S <u>19</u> T <u>43N</u> R <u>33W</u>	<u>8</u>	
	S _____ T _____ R _____	_____	
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____	
	S _____ T _____ R _____	_____	
4. Lot No. _____, Recorded Plat _____			
5. Private Claims			

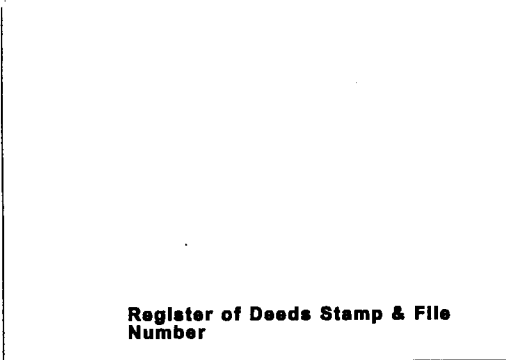

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7	●												
8	● 19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Stephan J. Szyszkoski, in a field survey on Jan 29, 2008 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(15-Sec. 18) West 1/16 corner between Sections 18 and 19. Not established in the original survey. The original Government plat gives dimensions 19.13 chains west and 20.16' chains east to Section corner and Quarter corner, respectively.

(8-Sec. 19) West 1/16 corner, Section 19. Not established in the original survey. Parenthetical distances derived from the original Government plat are 20.08 chains east to Center of Section and 19.47 chains west to Quarter corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(15-Sec. 18) Established the corner on the Section line between Section corner 1290.63' west and Quarter corner 1360.13' east, being proportionate to the dimensions given on the face of the Government plat.

(8-Sec. 19) Established the corner on a straight line between Center of Section 19 1341.47' east and Quarter corner 1300.71' west, being proportionate to the dimensions derived from the original Government plat.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(15) Set 1"IDx32" I.pipe with 4" alum. MDNR cap. Set measuring nail with MDNR tag in the side of:
 7" Sugar N47E 11.4' mrkd "1/16S BT"
 6" Y.Birch S25W 28.9' do
 8" Sugar N53W 26.8' do
 6" Sugar N30W 19.6' do
 Set sq'd post adjacent. Bearings are magnetic.

(8) Set 1"IDx32" I.pipe with 4" alum. MDNR cap. Set measuring nail with MDNR tag in the side of:
 7" Sugar N16E 14.9' mrkd "1/16S BT"
 4" twin Sugar S86E 28.3' do
 11" Sugar S21E 19.9' do
 11" Sugar N83W 37.5' do
 Set sq'd post adjacent. Bearings are magnetic.



Signed by Stephan J. Szyszkoski

Date 2/5/08

Surveyor's Michigan License No. 33986