

69.

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron	Located In:	Corner Code #
(County)		
1. Public Land Survey	T 44N R 31W	K9
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Jul 08 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:
(K9) Corner common to Sections 23-24-25-26. Original corner now falls under the surface of the Michigamme Reservoir. The corner is shown on a map prepared for Wisconsin Michigan Power Company titled "Michigamme River-Way Storage Dam Land Ties and Benchmarks" by Holland, Ackeraan, and Holland Rev. 12/7/53, map B G-154-66. Corner is described as Concrete monument with brass cap 400 ft. West. Bearing trees shown are: 2" Pop. N61E 25.1', 4" Pop. N25W 44.3', 10" Maple S85W 38.7". Found no subsequent record.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(K9) Original post and accessories presumed lost under the Michigamme Reservoir. Recovered the WMPCO monument, a 7" truncated right rectangular concrete pyramid with a 3" brass WMPCO tablet affixed on the top, in good condition, and at approximate record bearing and distance from the remaining two WMPCO witness trees found as follows: 10" Balsam Poplar N21W 44.3', 14" Sugar N88W 38.7' (with old face blaze and side scar). The brass cap is stamped "Wisconsin Michigan Power Company 44-31 23,24,25,26 400 ft. E. to cor". I accepted the monument as a reference to the original corner and reestablished the corner due east (astronomic or true east) 400.00 ft. from the monument. The corner position was not monumented. It's position was used to reestablished 1/16 and 1/4 corners on the West and South sides of Section 24. The witnesses shown below are to the Reference monument.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K9) Witnesses to the WMPCO concrete reference monument 400' W. of the corner. Blazed and scribed the following bearing trees:

6" Maple NOSE 3.7' "RM BT"
15" W. Birch S75E 36.4' "RM BT"
8" W. Spruce S16W 4.7' "RM BT"
12" Twin W. Birch S78W 10.6' "RM BT"
A 3 ft. tall 1" ID iron pipe is adjacent. Bearings are magnetic.

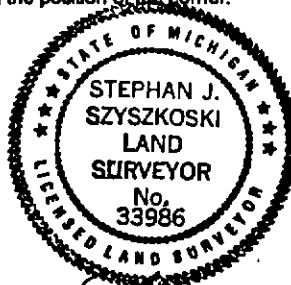

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date Sept. 8, 1997

For the Michigan Department of Natural Resources - Forest Management Division