

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

KALKASKA Located In: \_\_\_\_\_ Corner Code # \_\_\_\_\_  
 (County)  
**1998 REMONUMENTATION**  
 1. Public Land Survey T 25N R 8W E-4 \_\_\_\_\_  
 T \_\_\_\_\_ R \_\_\_\_\_  
 T \_\_\_\_\_ R \_\_\_\_\_  
 T \_\_\_\_\_ R \_\_\_\_\_  
 2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
 in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
 3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
 Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

**SURVEY &  
 REMONUMENTATION**

**FEB 22 1999**

**SECTION**

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, EUGENE FARRIER, in a field survey on November 4, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

E-4 : 1/4 Cor. Common to Secs. 8 & 9, T25N-R8W, Springfield Township  
 1852, GLO. sub. resurvey by V.W. Cankin D.S.; set post at corner; Cedar 7", N43°E, 75 Lks. (49.50'); Tamarack 8", S01°W, 1.27 Lks. (83.82') Small Lake, West, 30 Lks. (19.80'); Edge of swamp, North, 1.32 Ch. (86.79') & South, 4.44 Ch. (292.71')  
 10-7-74, C. Ostling, set 1/2" iron bar by single pro., Liber 1, Pg. 589, Cert. of Survey  
 1-26-77, F. Thomson, fd. 1/2" iron, Liber 1, Pg. 958, Cert. of Survey  
 7-20-83, R. Mitchell, found 1/2" iron, Liber 2, Pg. 778, Cert. of Survey  
 7-3-87, R. Mitchell, found 1/2" iron, Liber 3, Pg. 124, Cert. of Survey  
 9-7-88, J. Folkens, shows cor. only, Liber 3, Pg. 242, Cert. of Survey  
 9-7-88, J. Folkens, found re-rod w/cap #12026, LCRC, Liber 2, Pg. 354  
 11-21-89, E. Farrier, found 1/2" re-rod w/cap #12026, Cert. of Survey  
 3-20-95, E. Farrier, found 1/2" re-rod w/cap #12026, Cert. of Survey

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**


E-4 : 1/4 Cor. Common to Secs. 8 & 9, T25N-R8W, Springfield Township  
 Found and accepted 1/2" iron & cap #12026, +/- 25' East of E. Edge Lake (as recorded in LCRC and previous Cert. of Surveys) Pulled and set 5/8" X 36" re-bar w/ alum. cap.  
 N30°E, 11.78' - 4" Maple, found spike  
 N75°E, 8.08' - 5" W. Birch, found spike  
 S10°W, 2.55' - 4" Tamarack, found spike  
 N65°W, 5.78' - 5" Tamarack, found spike  
 No G.L.O. witnesses were found.

**Ratified by Peer Group**  
**P.A. 345 - 1990 Kalkaska County**  
 Chairman Eugene Farrier  
 Date 2-2-99

Kalkaska County Peer Group accepted the above monument as a careful and faithful reestablishment of the position of the original corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

E-4 : 1/4 Cor. Common to Secs. 8 & 9, T25N-R8W, Springfield Township  
 Found and accepted 1/2" iron & cap #12026, +/- 25' East of E. Edge Lake (as recorded in LCRC and previous Cert. of Surveys) Pulled and set 5/8" X 36" re-bar w/ alum. cap.  
 N30°E, 11.78' - 4" Maple, found spike  
 N75°E, 8.08' - 5" W. Birch, found spike  
 S10°W, 2.55' - 4" Tamarack, found spike  
 N65°W, 5.78' - 5" Tamarack, found spike

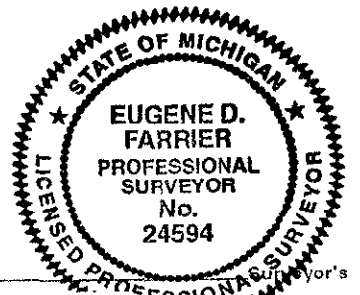

Signed by Eugene Farrier  
 Michigan License No. 24594

Date 2-2-99



**3012662**  
 Page: 1 of 1  
 02/10/1999 08:33A

Kalkaska County REMON 9.00 LB: 5 PG: 317

AL SURVEYORS, JAN. 28, 1971  
 REVISED MAY 14, 1975  
 REVISED JAN., 1983  
 REVISED OCT., 1996