

**SURVEY & REMONUMENTATION**

APR 28 1995

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

FILED  
FILED

Nov 16 1 59 PM '94

For corners in **COMMISSION**  
LIVINGSTON (County)

Located In: Corner Code #

NANCY HAVILAND  
REGISTER OF DEEDS  
LIVINGSTON COUNTY, MI  
48843

- 1. Public Land Survey T 2N R 3E G-12  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_
- 2. Property Controlling in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- 3. Miscellaneous Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

L.S.C.#326m

Register of Deeds Stamp & File Number

DARRELL HUGHES in a field survey on NOVEMBER 2, 19 94,  
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

IOSCO TWP.

A. Description of original monument and accessories and/or subsequent restoration:

GLO: 1825 Sylvester Sibley, Deputy Surveyor  
Tamarack 9" South 81 degrees West 2 links  
Tamarack 8" North 53 degrees East 11 links


\*Additional historical information on back of sheet

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Fd. 1/2" iron rod in centerline of gravel road at centerline of E/W culvert

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-12, T2N, R3E, IOSCO, replaced existing corner with 1-1/4" X 36" iron pipe, affixed with 2" dia. brass disk. Disk stamped "Livingston Co. Monumentation Corner, 19834" and is accepted as a careful and faithful reestablishment of the position of the original corner.  
068 DEG. 30.89' SET NAIL/TAG N/S UTILITY POLE.  
120 DEG. 26.48' SET NAIL/TAG TOP CENTER 6" DIA. WOOD COR. POST.  
209 DEG. 97.43' SET NAIL/TAG SE COR. RR TIE FENCE POST.  
229 DEG. 46.72' SET NAIL/TAG SE COR. RR TIE FENCE POST.

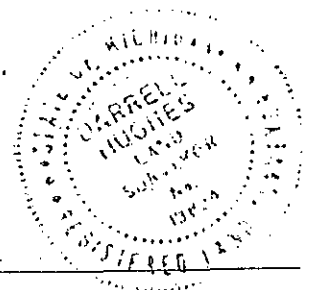

Signed by Darrell Hughes Date November 2, 1994  
Surveyor's Michigan License No. 19834

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983

PA. 545 1980, APPROVED BY LIVINGSTON COUNTY  
RECORDED ON 3 Aug 94 CL REP R. [Signature]

IOSCO TOWNSHIP, T2N, R3E

G-12, WEST 1/4 CORNER SEC. 34, EAST 1/4 CORNER SEC. 33.

FIELD 2-22-1994 D.D.HUGHES AND ASSOCIATES, FOWLerville.

Found 1/2" iron rod 0.5' below grade in centerline gravel road at centerline E/W culvert. Ditch runs East and West from point. Corner good for GPS. 1/2" iron rod set by Benton in 1973 (P. 10-11) "centered in bridge (culvert)".

Hughes and Benton are only recent surveys since set by Benton. Measures to North G-11: 2669.12 Hughes, 2668.65' Benton, GLO 40 chains; to South G-13, 2629.78' Hughes, 2629.91' Benton, 2628.62' Clay Gordon, GLO 40 chains; to East, 2649.23' Hughes, 2647.79' Gordon, 2647.16 Benton, 2645.28' Bullock.

1825 Sylvester Sibley, Deputy U.S. Surveyor, set 1/4 corner at 40 chains from South. P.7

1872 Miles Bullock divides all of Sec. 34. P.09

1953 Clay Gordon uses corner in survey P.9.

1973 Benton sets 1/2" iron rod. P.10-11.

1982 Benton survey. P.13.

1991 Hughes survey P.14

1994 Hughes survey P.14-15.