

**LAND CORNER RECORDATION CERTIFICATE**  
 Filing Requirement of Act 74, Mich. P.A. 1970

9-  
**FILED**

For corners in

<u>LIVINGSTON</u> (County)	Located in:	Corner Code #
1. Public Land Survey	T <u>4N</u> R <u>3E</u>	<u>C-13</u>
	T <u>   </u> R <u>   </u>	<u>   </u>
	T <u>   </u> R <u>   </u>	<u>   </u>
	T <u>   </u> R <u>   </u>	<u>   </u>
2. Property Controlling in Section	S <u>   </u> T <u>   </u> R <u>   </u>	<u>   </u>
	S <u>   </u> T <u>   </u> R <u>   </u>	<u>   </u>
3. Miscellaneous Property in Sec.	S <u>   </u> T <u>   </u> R <u>   </u>	<u>   </u>
	S <u>   </u> T <u>   </u> R <u>   </u>	<u>   </u>

1996 NOV 14 P 1:22

HANCY HAVILAND  
 REGISTER OF DEEDS  
 LIVINGSTON COUNTY, MI.  
 48943

L. S. C. #595m

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, DARRELL HUGHES, in a field survey on 10-24, 19 96 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

CONWAY

A. Description of original monument and accessories and/or subsequent restoration:

GLO: 1825  
 White Oak 24", North 73 degrees West, 27 links  
 White Oak 9", North 48 degrees East, 10 links

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1-1/4" pipe with brass cap set by Garlock in 1995 Remonumentation project.


\*Additional descriptions and historical information on back of this sheet.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-13, T4N, R3E, CONWAY, Found 1-1/4" X 36" iron pipe, affixed with 2" dia. brass cap, stamped "Livingston Co. Monumentation Corner, P.S. 14762, and is accepted as a careful and faithful perpetuation of the position of the original corner.  
 283 DEG. 20.67' FD. NAIL/ REMON. TAG S/S 48" OAK.  
 335 DEG. 96.68' FD. SE COR. HOUSE FOUNDATION.  
 002 DEG. 80.26' FD. NAIL/ REMON. TAG E/S 10" ELM.  
 177 DEG. 62.90' FD. NAIL/ REMON. TAG W/S 8" PINE.  
 014 DEG. 148.14' FD. NAIL/ REMON. TAG E/S 30" OAK.

Signed by [Signature]  
 Surveyor's Michigan License No. 19834

Date October 24, 1996

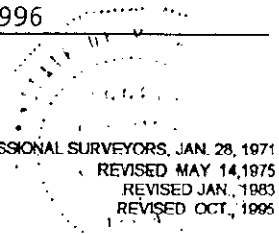

CONWAY TOWNSHIP, T4N, R3E

C-13, THE SOUTHEAST CORNER OF SECTION 31 AND THE SOUTHWEST CORNER OF SECTION 32, ON THE TOWNSHIP LINE.

FIELD: 6-21-1996 DARRELL D. HUGHES AND ASSOCIATES, FOWLERVILLE.  
9-17-1996 ADDITIONAL INFO AT SITE.

Found 1-1/4" pipe with brass cap stamped "Livingston County Monumentation Corner #14762", 0.2' below grade. Corner was set in April of 1995 by Charles Garlock, then being the Conway Township Remonumentation Surveyor, from many found accessories. Most prominent of those being a pointed green stone (lying 0.5' West and the 40" white oak, I believe to be the original witness tree (P.7). I suspect the stone was planted for the corner. No evidence of who set the stone. However, all recent surveys (1971 to present) have used an "iron" 0.5' East of said stone. On 9-17-96 we dug both east and west of existing pipe and found no green stone. Our measures West to B-13, North to C-12 and East to D-13 agree with past measures. I recommend, to the peer group, the acceptance of this pipe for the position of C-13. Marginal for GPS.

1824 Joseph Wampler, Deputy U.S. Surveyor, "West on the South boundary of Section 32, 80.00 chains, set post common to Sections 31 and 32. P.7-7B

1966 Lyle Munsell shows corner 108.34' West of centerline Stow Road and 1476.88 South of pipe at center of Allen and Stow Roads. P.8-8A

1971 July Survey by Garlock and Act 74. P.9-10

1971 Oct. Survey by Garlock and Act 74. New witness' P.11-12

1971 Sept. Survey by Oscar Boss and Act 74. P.13-14

1980 Lady Jane Lake survey by Boss. Defines well the relationship with centerline of Stow, C-1 and B-13. P.15-15C

1990 Brady surveys. P.16-16C

1994 Brewer RLS #6515 Act 74. Found 1/2" iron with cap #6515 at 338 Degrees and 2.15' from Garlock's 1995 corner. P.17

1995 Garlock notes for retracement of township line from C-13 to G-13. P.18-18B

1995 Garlock's 1995 Act 74's for C-13 and D-13. P.19-19A

1996 Witness comparison list. P.20-20A