

FILED

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

JUL 14 9 46 AM '95

NANCY HAVILAND  
REGISTER OF DEEDS  
LIVINGSTON COUNTY, MI  
48843

For corners in  
LIVINGSTON  
(County)

Located in:

Corner Code #

- 1. Public Land Survey      T 4N R 4E      C-11  
                                   T     R  
                                   T     R  
                                   T     R
- 2. Property Controlling    S     T     R  
    in Section               S     T     R
- 3. Miscellaneous           S     T     R  
    Property in Section     S     T     R

L.S.C. #414 m

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2				
3													
4	7		6		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Edward E. Anderson, in a field survey on June 30, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO Notes dated: June 20, 1823  
 GLO Witnesses: Spruce 15" S41E 40 Lks  
 Spruce 10" N37E 50 Lks

Additional historical data on back


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" capped iron. Fit witnesses by Boss, Garlock, C.H.M.P., and Shellenberger

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-11 NW COR SEC 32 T4N-R4E  
 Set 36" x 1 1/4" breakaway iron pipe with brass cap (Liv. Co. Mon. Cor.)  
 in centerline Flemming and Chase Lake Roads  
 N77°E 121.36' Spike S/S 15" Ash  
 S76°E 163.52' Spike S/S Quad 10" Poplar  
 S40°W 82.91' Spike E/S 16" Elm  
 N42°W 96.12' Spike S/S 14" Swamp Willow

Signed by \_\_\_\_\_  
 Surveyor's Michigan License No. 11495

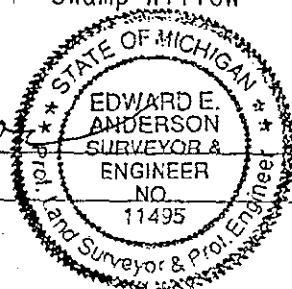

Date July 5, 1995

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
 REVISED MAY 14, 1975  
 REVISED JAN. 1983

P.A. 348 1990, APPROVED BY LIVINGSTON COUNTY  
 PEER REVIEWED ON 7-5-95



EDWARD E. ANDERSON, P.S., P.E.  
RICHARD F. FRANK, P.S.  
BRIAN R. SHALTZ, C.S.T.

Members of:  
Michigan Society of Professional Surveyors  
American Congress on Surveying and Mapping  
American Society of Civil Engineers

401 S. Leroy St.  
Fenton, Michigan 48430-2164

(313) 629-8974  
FAX (313) 629-9069

### SUMMARY

March 23, 1995

C-11 NORTHWEST CORNER SECTION 32, T4N-R4E, COHOCTAH TOWNSHIP,  
LIVINGSTON COUNTY, MICHIGAN

Found 1/2" capped iron (Boss) at the centerline intersection of Fleming and Chase Lake Roads (gravel)

Checked and measured to witnesses we found. Found 2 of 4 of Boss witnesses and they checked, pages 8, 10, 19, 22, and 26 this dossier. Found 4 of 6 of Garlock witnesses and they checked, pages 14 and 24 this dossier. Found 2 of 3 of C.H.M.P. witnesses and they checked, page 21 this dossier. Found 3 of 4 of Shellenbargers witnesses and they checked, pages 29 and 31 this dossier.

Distance from N.W. corner to the North 1/4 corner of said Section 32 is 2627.56', Boss surveys, pages 17, 18, and 25 this dossier; and 2627.36' C.H.M.P. survey, page 21 this dossier, and 2627.70' Shellenbarger survey, page 30 this dossier.

Distance from the N.W. corner to the West 1/4 corner of said Section 32 is 2654.60', Benton surveys, pages 15 and 16, this dossier.

Made a clean sweep of immediate area and found no other corners, or irons.

Gravel roads running north, south, east and west. All roads rise from the intersection.

Terrain is wooded in all directions.

Good location for G.P.S.

Came to the conclusion that the 1/2" rerod we found is the correct Northwest corner of said Section 32.

