

**SURVEY &  
REMONUMENTATION**

DEC 13 1993

**LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in **COMMISSION**

LIVINGSTON  
(County)

Located In: Corner Code #

- |                                    |   |          |   |          |             |
|------------------------------------|---|----------|---|----------|-------------|
| 1. Public Land Survey              | T | <u>4</u> | R | <u>5</u> | <u>M-11</u> |
|                                    | T |          | R |          |             |
|                                    | T |          | R |          |             |
|                                    | T |          | R |          |             |
| 2. Property Controlling in Section | S |          | T |          |             |
|                                    | S |          | T |          |             |
| 3. Miscellaneous Property in Sec.  | S |          | T |          |             |
|                                    | S |          | T |          |             |

HANGY HAYLAND  
REGISTER OF DEEDS  
LIVINGSTON COUNTY, MI  
48843

NOV 9 @ 45 AM '93

FILED

L.S.C. #34 m

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Edward Anderson, in a field survey on August 20, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

GLO NOTES DATED MAY 1, 1823  
GLO WITNESSES W. OAK 12" S32°W, 53 LKS  
W. Oak 11" N27°W, 53 LKS

ADDITIONAL HISTORICAL DATA ON BACK OF SHEET

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Found 1/2" x 18" Iron. Fit witnesses by Boss Engineering, E. E. Anderson & Assoc., Benton (Professional Surveyor)

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-11 NE CORNER SECTION 36, T4N-R5E  
Set 1 1/4" x 36" Breadaway Iron Pipe with Brass Cap (Livingston County Monument (Corner) in Gravel Road.  
N40°W, 60.33' Spike N/S 15" Hickory  
S10°W, 53.94' Spike W/S 16" Hickory  
S60°W, 48.43' Spike E/S 26" Hickory  
N50°W, 9.28' to 1/2" Iron in Roadbed

APPROVED BY LIVINGSTON COUNTY  
MONUMENTATION PEER GROUP  
OCTOBER 10, 1993

Signed by *E. Anderson*  
Surveyor's Michigan License No. 11495

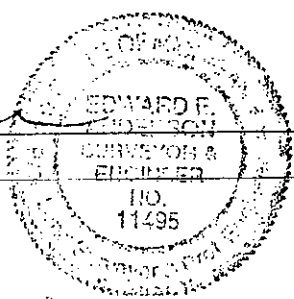

Date November 2, 1993

401 S. Leroy St.  
Fenton, Michigan 48430-2164

(313) 629-8974  
FAX (313) 629-9069

September 1, 1993

SUMMARY

M-11 NE CORNER SECTION 36, T4N-R5E, DEERFIELD TOWNSHIP,  
LIVINGSTON COUNTY, MICHIGAN.

Found 1/2" iron at the intersection of Faussett and McGuire Roads (gravel). This iron fit the witnesses to Boss (Act 74), one Boss survey, and one Anderson survey, Pages 22, 7B, and 17A, this dossier. These witnesses called this iron as the NE corner of Section 36, T4N-R5E, Deerfield Township.

This iron also fit the witnesses to one Benton Survey, Page 12 this dossier. These witnesses called this iron the SW corner of Section 30 or the NW corner of Section 31, T4N-R6E, Tyrone Township.

Found another iron to the North and West of the iron previously mentioned. This iron fit the witnesses to Pike (Act 74), one Benton Survey, and Garlock witnesses, Pages 11, 20, and 21, this dossier. These witnesses called this iron as the NE corner of Section 36, T4N-R5E, Deerfield Township. This iron also fits the witnesses Albright (Act 74). ~~These~~ Albright called this iron as the SW Corner of Section 30 or the NW Corner of 31, T4N-R6E, Tyrone Township.

The distance from the NE to the East 1/4 corner of said Section 36 was 2664.54' per Benton Survey Page 11, this dossier. I found two irons at the intersection of McGuire and Faussett Roads. I measured the distance to the most southerly iron at this intersection as 2661.26' and 2664.63' to the most northerly iron. The G.L.O. information shows the NW corner of Section 31, T4N-R6E, Tyrone Township to be 23 links or 15.18' North of the NE Corner of said Section 36.

Distances from NE Corner to the North 1/4 Corner of said Section 36 are shown on Anderson and one of Bentons surveys as 2665.46'. The distance on Boss and two of Bentons surveys as 2665.15. The distance on one of Bentons as 2657.24', Pages 7A, 11, 14A, 14B, and 17A, this dossier.

If we assume the most southerly iron I found at the intersection of Faussett and McGuire Roads is the correct iron for the NE corner of said Section 36, then three of Bentons, one of Bosses and one of Andersons surveys would indicate this; and Boss Act 74, one Boss witnesses and one Anderson witnesses would indicate this.

If we assume the most northerly iron I found at the intersection of Faussett and McGuire Roads is the correct iron for the NE corner of said Section 36, then one of Benton surveys, and Pike Act 74, and one Garlock witnesses would indicate this.

Made a clean sweep of the immediate area and found no additional corners or irons other than those stated above.

Found gravel roads to the North and South (McGuire Road) and West (Faussett Road) and East paved road (Faussett). Terrain was fairly flat with medium growth.

Came to the conclusion that the correct iron for the NE corner of said Section 36 was the most southerly iron I found. This conclusion based upon G.L.O. information showing the NE corner of said Section 36 to be South of the NW corner of Section 31, T4N-R6E, Tyrone Township, and also because of the discrepancies in the witnesses and 1/2 mile distances indicated above by the different surveyors and the fact that the majority of the surveys were based upon this iron being used as the NE corner of said Section 36, and also because of no other physical evidence or additional research available, I feel this is the only conclusion I could arrive at.

*E. Anderson*  
Edward E. Anderson \* STATE OF MICHIGAN \*  
EDWARD E. ANDERSON