

MACKINAC COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Mackinac

(County)

Located In:

Corner Code #

1. Public Land Survey	T	42N	R	6W	H-7
	T		R		
	T		R		
	T		R		
2. Property Controlling in Section	S		T	R	
	S		T	R	
3. Miscellaneous Property in Sec.	S		T	R	
	S		T	R	

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

RECEIVED & FILED
DIANE FRANKOVICH
MACKINAC COUNTY REGISTER OF DEEDS

NOV - 7 1995

AM 7 | 8 | 9 | 10 | 11 | 12 | 1 | 2 | 3 | 4 | 5 | 6 PM



Register of Deeds Stamp & File Number

I, James H. Granger, in a field survey on October 4, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

1845 Original Survey set wood post 8"birch S54°E 25 lks. 8"birch North 13 lks.
H. Brevoort

1915 D. Brotherton 1"x3" rod
1973 Lawrence Feindt #8887 fd railroad spike
1978 Max Connell #17616 replaced rr spike w/ 5/8" copper rod

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Worth Road reconstructed. Ex. 5/8" copper rod and witnesses measured by Northwoods Inc. prior to construction. 5/8" copper rod removed during construction.

SURVEY &
REMONUMENTATION

DEC 01 1995

COMMISSION


ACCEPTED BY THE MACKINAC COUNTY
SURVEY PEER GROUP AS THE
OFFICIAL CORNER UNDER P.A.
345 OF 1990 AT A MEETING
HELD ON 9-18-95

James H. Granger

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" rebar with remonumentation cap inside monument box.

fc. corner	N38°E	39.87'	fd p.k. nail
powerpole	S50°E	61.13'	fd tag
8"birch	S58°W	126.68'	fd tag
powerpole	N35°W	39.55'	fd tag

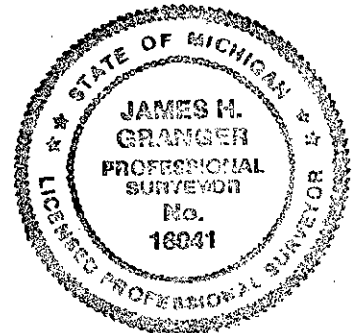

Signed by James H. Granger

Date 10/27/95

Surveyor's Michigan License No. 16041

D - 0365