6.27 = ITATION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 **Mackinac County Remonumentation Corner**

SECTION

For corners in

Mackinac County Located in: Corner Code # 1. Public Land Survey T44N R12W A-1)(Mackinac) T45N R13W M-13 (Schoolcraft) T44N R13W M-1 (Schoolcraft) T45N R12W A-13 (Luce) 2. Property Controlling S Т R in Section S Т R 3. Miscellaneous S T R Property in Sec. AUCEPTED BY THE MACKINAC COUNTY SURVEY PEER GROUP AS THE

RECEIVED & FILED DIANE FRANKOVICH MACKINAC COUNTY REGISTED OF DEEDS

FEB 25 2000

7 3 AM

71819119111412111213141510

- Paris

4. Lot No.

5. Private Claims


, Recorded Plat

OFFICIAL CORNER UNDER PA. 345 OF 1990 AT A MEETING FRETD ON 11-05-99

neis Entire

I, William L. Karr, in a field survey on November 11, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

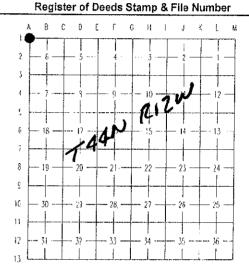

A. Description of original monument and accessories and/or subsequent restoration:

Township Corner Common to Section 31, Township 45 North, Range 12 West, Section 6, Township 44 North, Range 12 West, Section 1, Township 44 North, Range 13 West and Section 36, Township 45 North, Range 13 West.

1841 John Burt set post for the corner in original survey. Witnesses:

Hemlock 9" S39°W 25 lks Cedar 14" N50°E 4 lks.

Thomas O'Brien, P.S. 21274 recorded corner in Liber 2, Page 55 of Schoolcraft County Records. The corner was reestablished by double proportionate measurement between corners, 1/2 mile East, 1 1/2 miles West, 1/2 mile North and 1 mile South. Witnesses are 5" Spruce S26°W 9.55 feet, 5" Cedar S70°E 14.15 feet and 6" Spruce N27°W 13.30 feet.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner: A-1 Township Corner Common to Section 31, Township 45 North, Range 12 West, Section 6, Township 44 North, Range 12 West, Section 1, Township 44 North, Range 13 West and Section 36, Township 45 North, Range 13 West.

This corner is being perpetuated as part of the Luce County Remonumentation Program.

Found no evidence of original corner. Found 1" pipe with aluminum Schoolcraft County cap as recorded by O'Brien in 1987. Accepted corner position as found.

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Township Corner Common to Section 31, Township 45 North, Range 12 West, Section 6, Township 44 North, Range 12 West, Section 1, Township 44 North, Range 13 West and Section 36, Township 45 North, West. Range 13

Corner is a 1" pipe with aluminum Schoolcraft County cap.

· · · · · · · · · · · · · · · · · · ·			
Spruce 6"	N38°E	7.66 feet	
Cedar 7"	S76°E	14,17 feet	(existing)
Spruce 8"	S19°W	9.57 feet	(existing)
Spruce 7"	N34°W	13.26 feet	(existing)

Bearings are compass bearings, corrected for declination (6° W), all distances are to a nail and tag in the side of the witness object unless otherwise noted.

Date 12 - 29 - 44

Surveyor's Michigan License No.

27450

KARR LAND SURVEYOR No 27450