


LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>MACOMB</u> (County)	Located in: Macomb Township	Corner Code # <u>C-13</u>
1. Public Land Survey	T <u>3N</u> R <u>13E</u>	<u>C-13</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	<u>Seg. #2 pm</u>
	S _____ T _____ R _____	_____
3. Miscellaneous Property In Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

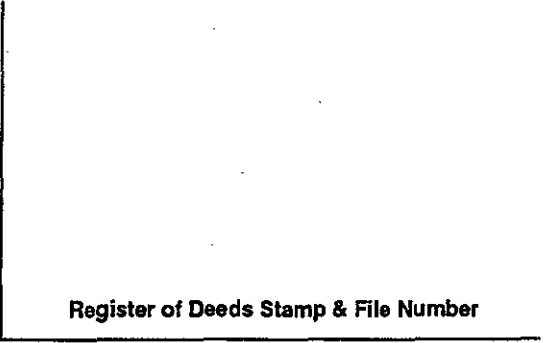

I, Randy Kolehouse, in a field survey on November 20 19 94, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	16	17	18	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

C-13 1817	G.L.O. Notes	Preston	N/A	Post
1971	MDOT Notes	N/A	N/A	1" Pin in Mon. Box
1972	L.C.R.C. L. 2336 P. 444	Soderberg	#17635	1 1/2" Dia. Rod in Mon. Box
1978	L.C.R.C. L. 2940 P. 350	Patterson	#17631	Iron in Mon. Box
1988	MDOT Notes	N/A	N/A	3/4" Rod in Mon. Box
1993	L.C.R.C. L. 6161 P. 247	Antcliff	#25826	M.C. Remon. Marker

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-13 Previous remonumentation iron and cap have been destroyed during M-59 reconstruction. Reset 3/4" rebar in an existing monument box using the following witnesses.

LCRC L. 6161 P. 247
 MDOT Nail & Tag in W Face P. Pole S 03° W 58.45'
 Nail & Tag and PK & Macomb Co. Remon. Tag in SE Face P. Pole N 34° E 132.07'

ACCEPTED BY THE MACOMB COUNTY SURVEY PEEI GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON 12-13-94
William E. Soderberg
 WILLIAM E. SODERBERG, P.S., CHAIRMAN

Measures East to D-13 = 2675.04' (MDOT Plans = 2675.09') (AEW 1992 = 2675.01') WW 1994 = 2675.02')
 Measures East to C-1 = 594.86' (MDOT = 594.85') (AEW 1992 = 594.87') (WW 1994 = 594.89')
 Measures West to B-1 = 2072.01' (AEW 1992 = 2072.00')
 Measures West to B-13 = 2664.26' (AEW 1992 = 2664.21') (MDOT = 2664.19')

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-13 I set a 3/4" x 24" iron rod w/2" diameter aluminum cap stamped "Macomb County Monument MI Act 345 #25854" in an existing monument box.

PK & Macomb Co. Remon. Tag SE Face Util. Pole N 34° E 132.07'
 Nail w/MDOT Tag W Face Util. Pole S 03° W 58.45'
 "+" in Sta. Stencil *421+00" S Edge E.B. M-59 S 35° W 76.04'
 "+" S Bolt Signal Pole Base N 38° W 61.75'

The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.



Signed by Randy J. Kolehouse
 Surveyor's Michigan License No. 25854

Date 12/16/94