

MONTCALM COUNTY REMONUMENTATION PROGRAM

DEC 19 2000

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970


SECTION

For corners in
Montcalm
(County)

Located In: Corner Code #

Montcalm Township

1. Public Land Survey	Sec 6	T 10N	R 08W	A-01, NW Corner
		T	R	
		T	R	
2. Property Controlling in Section	S	T	R	
	S	T	R	
3. Miscellaneous Property in Sec.	S	T	R	
	S	T	R	

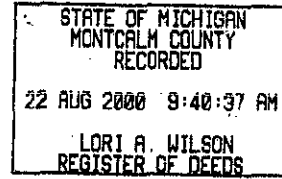

Register of Deeds Stamp & File Number

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

I, William Tingley a field surveyor on April 5, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6	5	4	3	2	1						
3													
4		7	8	9	10	11	12						
5													
6		18	17	16	15	14	13						
7													
8		19	20	21	22	23	24						
9													
10		30	29	28	27	26	25						
11													
12		31	32	33	34	35	36						
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- May 29, 1837, Noah Brookfield, Deputy Surveyor, GLO Notes
82.75 chains; intersected correction line 46.96 chains (3099.36 feet) East of Township corners
Set Post Corner Towns 10 North, Ranges 8 and 9 West
Pine 18" S12° 28 links (18.48 feet)
Elm 10" S42°E 22 links (14.52 feet)
- No date, R.D. McNutt's Index Cards 10-8 (1)
Pine 18" S12°W 28 links (18.48 feet)
Elm 10" S42°E 22 links (14.52 feet)
1876 remarked 1884
Pine 28" S29°W 33 links (21.78 feet)
- R.D. McNutt, County Surveyor, Index Card File 11-8 (116)
South Quarter Post Section 31 11-8 is 4.86 chains (320.76 feet) West of Northwest Corner Township T10N-R08W

ACCEPTED BY THE MONTCALM COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 6/14/00

William Tingley, PS, Chairman

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Searched apparent location of the corner. Excavated 12", found railroad spike and very large rock (Approx. 100 lbs.) nothing else to original grade-2.00 feet below the surface of the road. An occupation tree line extends south from this point. Measured distance to T11N-R08W B-13 as 328.92 feet. B-13 is in line with occupation tree line to north. Used Railroad spike as the best available evidence.

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set remonumentation pipe in place of railroad spike at occupation treeline and on true line.

Set N/T W/S 21" oak	N54°E	46.76 feet
Set N/T W/S 21" oak	N20°W	30.75 feet
Set N/T NE/S 9" maple	S77°W	101.44 feet
Set N/T E/S 12" poplar	S00°E	47.76 feet
Distance to T11N-R08 B-13 West		328.92 feet

This corner is accepted as the best available evidence of the position of the original corner.

Bearings given are magnetic. Standard remonumentation consists of a Berntsen stainless steel 2 3/8" x brass cap stamped "MONTCALM COUNTY REMONUMENTATION, P.S. # 30104"



igned by William Tingley Date 6/14/00
urveyor's Michigan License No. 30104

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1993



LIBER 4

PAGE 254