

**SURVEY &
REMONUMENTATION**

MAY 28 1997

LIBER 308 PAGE 705

**LAND CORNER RECORDATION CERTIFICATE
COMMISSION Filing Requirement of Act 74, Mich. P.A. 1970**

1074

For corners in Missaukee Located In: Corner Code #
(County)

1. Public Land Survey	T	<u>22N</u>	R	<u>6W</u>	<u>M-7</u>
	T		R		
	T		R		
	T		R		
2. Property Controlling in Section	S		T	R	
	S		T	R	
3. Miscellaneous Property in Section	S		T	R	
	S		T	R	

MISSAUKEE COUNTY MICHIGAN
RECORDED **DEC 20 1996** 9:45 A.M.
Paulyn Klare
REGISTER
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, J. Dean Geers, in a field survey on December, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	8	5	4	3	2	1						
3												
4	7	6	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- M-7) 1837 GLO Section Post by John Brink, Deputy Surveyor; Sugar 10-N84W-38; Beech 12-S40W-58
- M-7) 1898 Co. Survey in Section 19, T22N, R5W; WPS 48-N19E-1.08
- M-7) 1899 Richardson Survey in Section 13, T22N, R6W; WPS 48-N19E-1.08
- M-7) 1913 Beuthien Survey in Section 19, T22N, R5W; WPS 48-N19E-1.08
- M-7) 1980 DNR Survey in Section 24, T22N, R6W, Proj. No. 02-5562; Found 5/8" Iron bar

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


- M-7) Corner common to Sections 24 and 13, T22N, R6W and Sections 18 and 19, T22N, R5W; Found 5/8" Iron of record 7± Southerly of Centerline Road to West, 4± Northerly of Centerline Road to East, 3± Easterly Centerline Road North and South. This corner is accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- M-7) Set Missaukee Co. Mon. on existing Iron
 - N50E - 72.19 - Found Nail 8" Red Pine
 - N60W - 47.90 - Found Nail 10" Twin Oak
 - N40W - 62.57 - Found Nail 12" Oak
 - S60W - 37.00 - Found Nail by telephone pedestal

Peer Group Reviewed and Approved

Date: 12-19-96
J. Dean Geers
J. Dean Geers, Missaukee Co. Representative

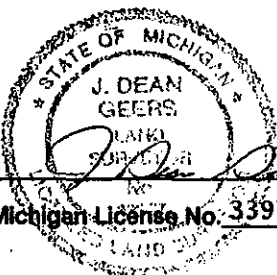

Signed by _____
Surveyor's Michigan License No. 33977

Date 12-19-96