

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

94 JAN 21 PM 3 27

For corners in

Newaygo (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>14</u> N R <u>12</u> W	F-13
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

Marlene Toogood

VOL 001 PAGE 43

Register of Deeds Stamp & File Number

I, Norman L. Ochs, in a field survey on December 13, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

S. 1/4 Corner, Section 33, Wilcox Twp., Newaygo Co., MI

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. John Hodgson 1837  
 12" Hemlock N68°E 14 lks. (9.24') #1  
 30" Lynn N78°W 10 lks. #2

March 03, 1993  
 Newaygo Eng. & Survey Co.  
 Found 5/8" Iron Rod  
 King Bolt West 9.48' (N. 1/4 Corner  
 Sec. 4, Everett Twp.) #3  
 Telephone Rise N39°W 71.70' #4  
 7" W. Pine N18°E 99.83' #5  
 9" W. Pine S46°E 120.88' #6  
 Corner Fence Post S45°W 67.00' #7

April 12, 1979  
 Newaygo Eng. & Survey Co.  
 Iron in Monument Box  
 N. 1/4 Cor. Sec. 4, Everett Twp.  
 (King Bolt) West 9.48' #3

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

In 1930 Lyle S. Shepherd broke the SE. 1/4 of Sec. 33, Wilcox Twp. Shepherd found the N. 1/4 Corner of Everett Twp., to be 9.90 feet West of the S. 1/4 Corner of Sec. 33, Wilcox Twp. Shepherd measured 2654.10 feet from the SE. Corner to S. 1/4 and measured 2633.00 feet from the S. 1/4 Corner to the C. 1/4 Corner. This information is found in Field Book 70 Page 46 at the Newaygo County Surveyor's Office. In 1945 Ralph A. Smith also found the N. 1/4 Corner of Sec. 4, Everett Twp. to be 9.90 feet West of the S. 1/4 Corner of Sec. 33, Wilcox Twp. This information is found in Field Book 70A Page 23 and Field Book 68 Pages 72 and 73. Smith measured 2654.10 feet from the S. 1/4 Corner to the SE. Corner and measured 2632.10 feet from the S. 1/4 Corner to the C. 1/4 Corner. I, Norman L. Ochs found a 5/8" Rod and replaced (in the exact location) with a 4" Harrison Cast Iron Monument. I measured 2630.74 feet from the S. 1/4 Corner to the C. 1/4 Corner and measured 2657.07 feet from the S. 1/4 Corner to the SE. Corner and found the N. 1/4 Corner of Sec. 4, Everett

SEE OVER-----

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Accepted 4" Harrison Cast Iron Monument as a substantial marker for the 1/4 Corner and is accepted as a careful and faithful reestablishment of the original corner.

Corner Fence Post S45°W 67.00' #7  
 N. 1/4 Corner Sec. 4, Everett Twp. (iron in Mon. Box) West 9.48' #3  
 P. Pole S45°W 58.45' Spike in West side of pole  
 8" W. Pine N25°E 99.83' Spike in West side of tree #5  
 12" W. Pine S45°E 120.89' Spike in NE. side of tree  
 P. Pole S10°E 46.82' Spike in West side of pole

Signed by Norman L. Ochs  
 Norman L. Ochs  
 Surveyor's Michigan License No. 22439

Date December 29, 1993

Approved by Peer Group December 29, 1993  
 Norman L. Ochs, County Representative

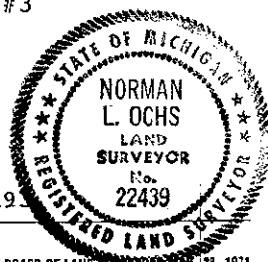

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, 23, 1971  
 REVISED MAY 14, 1975  
 REVISED JAN. 1993

SURVEY & REMONUMENTATION

JEC 07 2000

SECTION

B. Continued.....  
Twp. to be West 9.48 feet .

Condition of recorded witnesses is; #1 and #2 Gone #3 Good Condition #4 Gone  
#5 Good Condition #6 Gone #7 Good Condition.

SURVEY &  
REMONUMENTATION

JEC 07 2000

SECTION