

**SURVEY & REMONUMENTATION**

DEC 01 1998

RECORDED

98 MAY 22 PM 4:06

Ottawa County Remonumentation  
**LAND CORNER RECORDATION CERTIFICATE**  
 Filing Requirement of Act 74, Mich. P.A. 1970

**SECTION**

For corners in

<u>Ottawa</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>5N</u> R <u>15W</u>	A-5 (NW, 18) Holland Twp.
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

*Ray Schiller*  
 REGISTER OF DEEDS  
 OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

I, John C. Bueche, in a field survey on April 3, 19 98, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

A-5 GLO Calvin Britain, 1832 West boundary 47 North of post & set cor. secs. 7 & 18 Hemlock 20 S 60 E 29 Hemlock 30 N 56 E 26	LCRC 1-251, Feb., 1972 Fnd. steel rod SE hse. cor. NW 67.58' SW hse. cor. NE 102.13' Bent nail in 30" Maple NW 51.92' Nail in PP S 80° E 25.60'	LCRC 1-805, Dec., 1972 TP NE 25.52' PP SW 61.91' C/L st. sign SE 69.10' SE cor. hse. NW 67.60' Park Twp. cor. S. 32.47'
---	---	--

OVER

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


A-5 Found 3" Harrison Mon. in Mon. Box on Township Line between M-5 (NE 13) & M-4 (E 1/4 12), 5-16; on C/L bit. road N-S; C/L bit. road South 33'±  
 SE hse. cor. NW 67.58'  
 30" Maple NW 51.92'  
 Park Twp. cor. S. 32.47'

And is accepted as a careful and faithful perpetuation of the position of the original corner.

P.A. 245 OTTAWA COUNTY  
 DEED APPROVED 4/20/98

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-5 3" Harrison Mon. in Mon. Box on Township Line  
 SW cor. hse. fnd. N 75° W 88.83'  
 SE cor. conc. porch S 30° W 136.91'  
 SW cor. hse. fnd. S 20° E 150.55'  
 Nail & Ottawa Co. Remon. Tag in S side UP S 75° E 32.86'  
 Ottawa Co. Mon. M-5 (NE 13, 5-16) South 32.46'

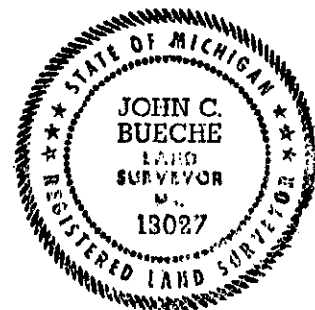

\* 11.00 CORNER  
 \* 2.00 PHOTO

Signed by John C. Bueche Date 4-13-98  
 John C. Bueche, P.S. 13027  
 Surveyor's Michigan License No. \_\_\_\_\_

**SURVEY &  
REMONUMENTATION**

DEC 01 1998

A-5  
PART A - continued

SECTION

LCRC 3-393, Oct., 1979  
Fnd. steel rod  
ESE TP 25.52'  
WSW GP 52.23'  
NW SE cor. hse. 67.60'  
S. Park Twp. cor. 32.47'

Joiner, 1989 (from HEI notes)  
Fnd. capped iron set CIM  
Nail in 38" Maple WNW 51.84'  
Nail in PP ESE 25.73'  
C/L gas pipeline marker SW 38.13'  
Park Twp. cor. S 32.46'

Exxel Survey, June, 1984  
Fnd. 3" CI Mon.  
C/L hydt. ESE 38.41'  
Nail & Tag in PP SW 62.30'  
SE cor. hse. NW 67.60'

