

# SURVEY & REMONUMENTATION

APR 25 1995

COMMISSION

OTTAWA COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

94 DEC -8 PM 12:33

*Robert A. Williams*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI

For corners in OTTAWA

Located In: Corner Code #/

	5N	15W	L-9 (S 1/4 cor of Sec. 24) of Holland Twp.
1. Public Land Survey	T ___ R ___	T ___ R ___	_____
	T ___ R ___	T ___ R ___	_____
	T ___ R ___	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	S ___ T ___ R ___	_____
	S ___ T ___ R ___	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	S ___ T ___ R ___	_____
	S ___ T ___ R ___	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Randal J. Vugteveen, in a field survey on November 17, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:  
L-9 common corner to Sections 24 & 25

1832 - Brookfield  
Set post  
Hemlock 10" N28E 24 Links  
Sugar 30" S25W 23 Links

Liber 2, Page 345  
1" iron centerline road  
P.P. N10E 53.25'  
SW cor. brick gar. N35E 135.38'  
8" Cherry N70E 68.8'

Liber 3, Page 306  
Found steel bar  
SW cor brick gar. N35E 135.38'  
8" Cherry N70E 69.32'  
Guy Pole SSE 21.42'


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
L-9 Found CIM in mon box 0.5' of centerline Perry and accepted as a careful and faithful perpetuation of the position of the original corner  
SW cor brick gar N35E 135.38'

RIA. 345 OTTAWA COUNTY  
PEER APPROVED 11/21/94

*Robert A. Williams*

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
L-9 Cast Iron Monument

Set Ottawa County Remon Tag & Nail in W side P. pole N7E 27.83'  
Set Ottawa County Remon Tag & Nail in SW side guide pole S37E 57.64'  
Top hydrant N54E 49.80'  
SW corner brick garage house #9999 N35E 135.41'

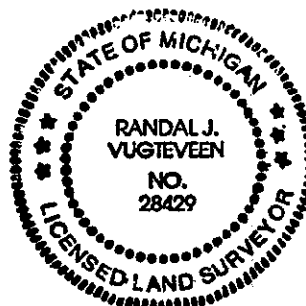

Signed by Randal J. Vugteveen  
Surveyor's Michigan License No. 28429

Date Nov. 21, 1994