

**SURVEY &
REMONUMENTATION**

APR 24 1995

COMMISSION

For corners in

OTTAWA COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

94 DEC 15 AM 11:50

Daphne Robinson
REGISTER OF DEEDS
OTTAWA COUNTY, MI

Ottawa (County)	Located In: Robinson Twp.	Corner Code #
1. Public Land Survey	T <u>7N</u> R <u>15W</u>	<u>L-5</u>
	T _____ R _____	<u>N 1/4 Corner</u>
	T _____ R _____	<u>Section 13</u>
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Carl P. Englert in a field survey on December 08, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

L-5 1/4 corner common to Sections 12 & 13
Original Gov't corner set May, 1832
by Calvin Britain, D.S.

LCRC Liber 4, Page 92 (7/30/80)
Steel Fence Post
15" Ash N 35.85'
7" Maple SSW 71.00'
18" Cottonwood WSW 48.44'
24" Cottonwood NE 36.25'

Cedar 10" is Post

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

L-5 1/4 corner common to Sections 12 & 13

Found Steel Fence Post in N & S Ditch
Found Stump N.E. 36'+/-
Found Down Tree WSW 48'+/-

PA. 345 OTTAWA COUNTY
PEER APPROVED 12/12/94


Accepted as a careful and faithful perpetuation of the original position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-5 1/4 corner common to Sections 12 & 13

Set 3/4" x 3' long Steel bar with O.C. Remon. cap at water level
Placed Steel fence post next to corner
O.C. Remon. Tag & Nail in E. side 16" Maple S30°W 68.50'
O.C. Remon. Tag & Nail in E. side 10" Ash N20°W 87.50'
O.C. Remon. Tag & Nail in S.E. side 10" Ash N45°E 87.90'
O.C. Remon. Tag & Nail in E. side Tw. Maple S 5°W 95.18'

Signed by Carl P. Englert Date 12/11/94
Surveyor's Michigan License No. 18987

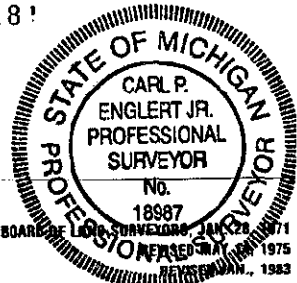

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, 2004, 2007, 1975, 1983