

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970
 Ontonagon County Remonumentation Corner

For corners in
 Ontonagon County Located in: Corner Code #
 1. Public Land Survey T51N R39W E-6
 T R
 T R
 T R
 2. Property Controlling S T R
 In Section S T R
 3. Miscellaneous S T R
 Property in Sec. S T R
 4. Lot No. , Recorded Plat
 5. Private Claims

**SUBVEY &
 REMONUMENTATION**
MAR 23 2000
SECTION

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Joseph C. Domitrovich, in a field survey on August 22, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(E-6) 1/4 Corner Common to Sections 16 and 17, T51N, R39W.

- 1845 - Austin Burt set a Sugar Post
- 18" Hemlock S 30° E 7 links
- 14" Hemlock N 18° W 28 links

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


I found no remains of the original corner or accessories. At the 1/4 corner position I found a North - South Paved road (Woodspur Road) running along the Section line and a fenceline running East along the 1/4 line. I created a position for the 1/4 corner at the intersection of centerline of the North - South road and the extension of the fence to the east. This position is 2644.32 feet north of the Southeast corner of Section 17 and is the best remaining evidence of the 1/4 corner position.

Research on file with County Remonumentation Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 5/8" iron pin with a 3" diameter brass cap stamped to read: COUNTY REMONUMENTATION; T.51N, R.39W; 1/4; S.17, S.16; 1999; P.S. 37273. Corner falls at the intersection of centerline of Woodspur Road and the extension of a fenceline to the East. I also established a Reference Monument (R.M.) to the east; a 3/4" x 48" aluminum rod with a 3" diameter aluminum cap stamped to indicate that the 1/4 corner is S88°57'W 33.43'. Ties:

Power Pole	N 19° E	101.82'
R.M.	N 88°57'28" E	33.43'
Power Pole	S 10° E	196.83'
Northwesterly Garage Corner	N 84° W	112.55' (to corner of block)
SE Corner of Sec. 17	S 00°12'57" E	2644.32 (2640 GLO)
NE Corner of Sec. 17	N 00°12'59" W	2631.12 (2640 GLO)

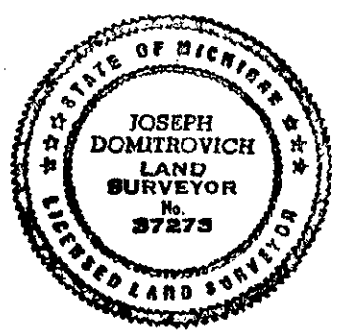

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

BEER GROUP APPROVED
Carl W. Appelkamp 8-24-99
 COUNTY REPRESENTATIVE

Signed by J. C. Domitrovich
 Surveyor's Michigan License No. 37273

Date 8/24/99