

**SURVEY &
REMONUMENTATION**

FEB 0 8 2008



DELIVERED TO NEWAYGO CO.
01/22/2008 3:43:01 PM

SECTION

2007 Newaygo County Remonumentation Project

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Newaygo
(County)

Located in: _____ Corner Code #

1. Public Land Survey

T15 N R11 W
T N R W
T N R W
T N R W
T N R W
T N R W
T N R W
T N R W

_____ Corner Code #

VOL. 6 55

- 2. Property Controlling in Section _____
- 3. Miscellaneous Property in Sec. _____



- 4. Lot No. _____
- 5. Private Claims _____

Recorded Plat _____

LINDA M. LANDHEER
NEWAYGO COUNTY REGISTER OF DEEDS
RECEIVED AND RECORDED
01/22/2008 4:03:22 PM

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	28	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Norman L. Ochs, in a field survey on May 25, 2007 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Note: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Quarter corner common to Sections 11 and 12, Norwich Township.

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

GLO - Resurvey
Milton Nye - 3rd quarter 1856
Re established old quarter section post
#1 11" Beech S87°W 39½ links (26.07')
#2 9" Beech S2°E 10 links (6.6')

Lyle S. Shepherd, R.L.S. #503
Book 37, Pages 8 and 9 and Book B, Pages 82 and 88, 1917
Pine Root - Iron - Glass
#3 30" Pine Stump West 50' **OVER**

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:


I found a ½" x 18" re-rod with cap #33139 (Thomas H. Sage, P.S.). The centerline of the North and South gravel road is 2.0' West of corner and on line with East and West fences. The condition of the witnesses are as follows: #1 thru #4 gone, #5 thru #8 are gone.

C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

I removed the ½" x 18" re-rod with cap #33139 and set a 4" diameter Harrison cast iron monument 20" long marked "County Surveyor #22439" .5' below grade as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original quarter corner.

- #5 Fence Post West 31.78'
- #6 12" White Oak S45°W 28.92'
- #7 10"-20"-24" Tri-Red Oak N37°E 25.51'
- #8 12" Red Oak S45°E 39.81'

- Found spike with cap in South side
- Found spike with cap in East side
- Found spike with cap in East side
- Found spike with cap in West side

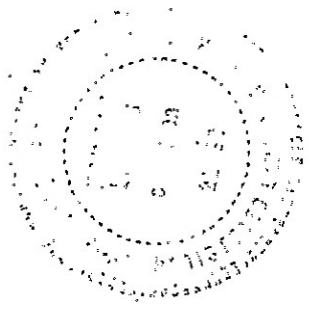

Signed by Norman L. Ochs
Norman L. Ochs

Date January 14, 2008

Surveyor's Michigan License No. 22439

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971

Approved by Peer Review Group on June 21, 2007
Norman L. Ochs, County Representative.

Revised May 14, 1975
Revised Jan., 1963