

**SURVEY &
REMONUMENTATION**

FEB 08 2008



DELIVERED TO NEWAYGO CO.
01/22/2008 3:43:01 PM

SECTION 2007 Newaygo County Remonumentation Project

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Newaygo
(County)

Located in: Corner Code #

VOL. 6

26

- Public Land Survey
T14N R11W D-11
T N R W
T N R W
T N R W
T N R W
T N R W
T N R W
T N R W
- Property Controlling in Section
S
- Miscellaneous Property in Sec.
S
S
S

LINDA M. LANDHEEP
NEWAYGO COUNTY REGISTER OF DEEDS
RECEIVED AND RECORDED
01/22/2008 4:03:22 PM



Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	6	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

- Lot No. _____ Recorded Plat _____
- Private Claims _____

I, Norman L. Ochs, in a field survey on May 21, 2007 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Note: Not more than 2 corners, all in the same town and range, may be Recorded on this certificate.

Quarter corner common to Section 29 and 32, Goodwell Township.

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

GLO-J.H. Mullett
4th quarter 1837
Set quarter section post
#1 24" Pine N4°W 13 links (8.58')
#2 12" Beech S3°W 44 links (29.04')
Delos G. Anderson
Book A, page 216
September 14, 1897
#3 22" Pine N75½°E 45 links (29.7')
#1 Pine N4°W 13 links (8.58') **OVER**

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:


I found a ¾" x 26" iron pipe with cap "illegible" inside the pipe. The corner is ± in the centerline of North, South, East and West two-track. The condition of the witnesses are as follows: #1 thru #3 gone, #4 good, #5 found 16" stump S80°W 5.80' center, #6 and #7 good.

C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

I removed the ¾" x 26" iron pipe with illegible cap and set a 4" diameter Harrison cast iron monument 20" long marked "County Surveyor #22439" at ± grade as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original quarter corner.

- #4 14" White Oak S33°E 41.36'
- #6 2"-4"-12" Tri-Maple N20°E 17.68'
- #7 14" White Oak N73°W 18.73'
- 8" White Oak S42°W 45.98'

- Set 40d spike with tag in NE side
- Set 40d spike with tag in West side
- Set 40d spike with tag in North side
- Set 40d spike with tag in SE side

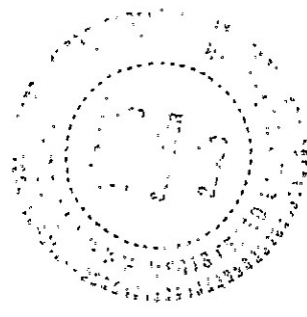

Signed by Norman L. Ochs Date January 14, 2008

Norman L. Ochs

Surveyor's Michigan License No. 22439

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971
Revised May 14, 1975
Revised Jan., 1983

Approved by Peer Review Group on June 21, 2007

Norman L. Ochs, County Representative.

M.L.O.