

**SURVEY &
REMONUMENTATION**

MAR 02 2009



DELIVERED TO NEWAYGO CO
02/05/2009 3:11 56 PM

SECTION 2008 Newaygo County Remonumentation Project


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Newaygo
(County)

Located in: Corner Code #

VOL. 6 143

- 1. Public Land Survey T13N R11W K-6
- 2. Property Controlling in Section S
- 3. Miscellaneous Property in Sec. S

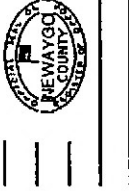

LINDA M. LANDHEER
NEWAYGO COUNTY REGISTER OF DEEDS
RECEIVED AND RECORDED
02/05/2009 3:19:08 PM

Register of Deeds Stamp & File Number

- 4. Lot No. _____ Recorded Plat _____
- 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Norman L. Ochs, in a field survey on January 10, 2008 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below

Note: Not more than 2 corners, all in the same town and range, may be Recorded on this certificate.

One Quarter Corner common to Sections 13 and 14, T13N R11W, Big Prairie Township.

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

- GLO - James H Mullett 4th quarter 1837 Set quarter section post
- #1 18" White Oak S50°E 12 links (7.92')
- #2 12" White Oak N89°W 9 links (5.94')

- Lyle S Shepherd, R.L.S. # 503 Book 21, Page 46 August 19, 1927
- #3 6" Pine N41½°E 36½ links (24.09')
- #4 7" Pine S66½°W 47½ links (31.35')

OVER\$

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:

I found clay tile filled with concrete with "+" on top. The centerline of a gravel road going East is 15.0' South. The centerline of a gravel road going South is 10.0' East. The condition of the witnesses are as follows: #1 and #2 gone, #3 in good condition, #4 and #5 gone.

C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

I drilled "+" on top of clay tile and set a ½" diameter Rerod 9" long with cap # 22439 .3' below grade in exact location of the clay tile as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original quarter corner.

- #3 36" White Pine N43°E 24.64'
 - 10" - 16" Clump Maple S72°W 66.98'
 - 22" White Oak N70°W 68.69'
 - 10" White Oak S33°E 24.41'
 - ½" Rod with cap # 22439 S41°W 22.65'
- Found spike with tag in Northwest side
Found spike in Northwest side
Found spike in South side
Set 40d spike with tag in Southwest side

Signed by Norman L. Ochs
Norman L. Ochs

Date January 23, 2009

Surveyor's Michigan License No 22439

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971
Revised May 14, 1975
Revised Jan , 1983

Approved by Peer Review Group on July 16, 2008
Norman L. Ochs, County Representative.

M.L.O.

