SURVEY & REMONUMENTATION

JAN 16 2004

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filling Requirement of Act 74, Mich., P.A. 1970

For corners in Lake (County)

		Located in:	Corner Code#
1. Public Land Survey		T18N R14W	F-9
		T__N R__W	
		T__N R__W	
		T__N R__W	
2. Property Controlling	S___	T__N R__W	
in Section	S___	T__N R__W	
3. Miscellaneous	S___	T__N R__W	
Property in Sec.	S___	T__N R__W	

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Register of De

RECORDED LAKE COUNTY, MI 21 OCT 2003 1:02:07 PM SHELLY MYERS REGISTER OF DEEDS

Liber 5 Page 240

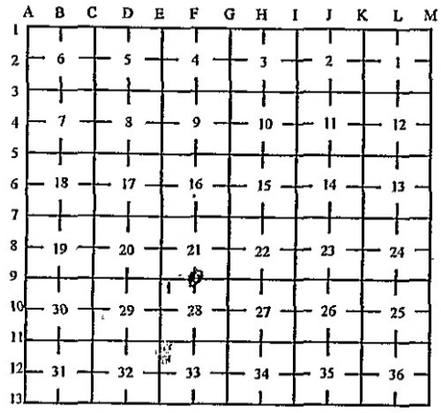

I, Robert L. Wetherell, in a field survey on July 14, 2003, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

F-9 ¼ Corner common to Sections 21 & 28

A. Description of original monument and accessories and/or subsequent restoration:

1938 S. Sibley, G.L.O.
"12" Pine for Corner Tree"

1908 G. West, Co. Surveyor
Section map shows distance across South Mile of 75.54' with no ¼ corner shown

1957 G. Blass, L.S. 5489
"T" iron (set by S.P. Method)
#1. 7" Black Oak N80°E 2.25'
#2. 6" White Oak S43°E 34.00'
#3. 10" White Oak S50°W 104.10'

1964 R. Griffin, L.S. 13584
L.C.R.C., L.01, Pg. 110
Found "T" iron, set 5" sq. monument
#1. 7" Black Oak N80°E 2.47'
#2. 8" White Oak S43°E 34.13'
#3. 10" White Oak S50°W 104.30'
#4. 5" Red Pine S83°W 46.98'
#5. Post N. 1.8'

1988 S. Barnett, L.S. 16923
Survey Record L.03, Pg. 148
#6. Distance West = 2495.48'
#7. Distance East = 2495.86'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found Griffin's 5" monument 60 feet (+/-) North of East West gravel road and in an old East & West fence line (down). It checks well with recovered accessories.

Condition of Accessories: #1, Found in good condition, #2, Found in good condition, #3, Found in good condition, #4, Found in good condition, #5, Found in good condition, #6, Did not measure, #7, Did not measure.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I accepted the 5" concrete monument as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original corner.

13" White Oak	S45°E	34.16'	(Dock spike in SW side) #2
12" Red Pine	S89°W	46.98'	(Dock spike in N. side) #4
5" White Pine	S60°W	57.68'	(60 d. spike in SE side)
16" Black Oak	N22°E	59.59'	(60 d. spike in NW side)

STATE OF MICHIGAN * ROBERT L. WETHERELL PROFESSIONAL SURVEYOR No. 24624 * LICENSED PROFESSIONAL SURVEYOR

Signed by Robert L Wetherell Date Oct. 14, 2003
Surveyor's Michigan License No. 24624

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP IN ACCORDANCE WITH P.A. 345
CHAIRMAN RJW DATE: 10-09-03

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS JAN. 28, 1972
REVISED MAY 14, 1975
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING JANUARY, 1999