

MAR 03 2000

# LAND CORNER RECORDATION CERTIFICATE

SECTION

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

1999 Alcona County Remonumentation

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T.25N N. S., R.6E E. W.	C-3
2. PROPERTY CONTROLLING IN SECTION_____	,T. _____ N. S., R. _____ E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION_____	,T. _____ N. S., R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

Alcona County Remonumentation Liber 2 Page 18

U Filed for Record in ALCONA COUNTY MICHIGAN DORIS A GAUTHIER On 12-17-1999 At 10:32 LAND CORNER 9.00

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, John F. Oliver do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram-over) were, in a field survey on Dec. 8, 1999, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- C-3: 1845: GLO survey by J. Mullett - set post and referenced
- 1900: sur. by A. Freer - corner is not described
- 1914: sur. by A. Freer - cor. is gray boulder 18 x 14 x 8 w. glass
- 1953: MDOT Plans - cor. show - no description for corner
- 1983: USFS, J. Williams - corner is conc. mon. with brass cap
- 1993: sur. by NE land surveys - corner is mon. with brass cap
- 1996: sur. by F. King - double rods in conc.
- 1999: sur. by J. Oliver - fd. 5/8" rod

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-3: fd. 2 - 3/8" rods in conc. with 5/8" rod alongside with two USFS witnesses from 1983 survey
- no evidence recovered from GLO survey of 1845
- distance and alignment are compatible with surveys of 1983 and 1993
- accepted as the correct location for the corner

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- C-3: placed 1/2" rod and aluminum cap alongside conc. mon. after removing top portion of old mon referenced:


APPROVED LAND CORNER (USFS CORNER 1983) pow. pole / S 52°E / 75.80' to exist. nail  
 P A 345 of 1990 conc. post / S 44°W / 35.60' to center  
 ALCONA COUNTY 6" elm / N 35°E / 70.72' to nail  
 Date 11/30/99 1/2" rod and cap / N 52°E / 46.61'  
 County Rep. [Signature]

SIGNED BY \_\_\_\_\_ DATE Dec. 8, 1999  
John F. Oliver  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 19840

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
 CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
 MICHIGAN REGISTERED LAND SURVEYOR

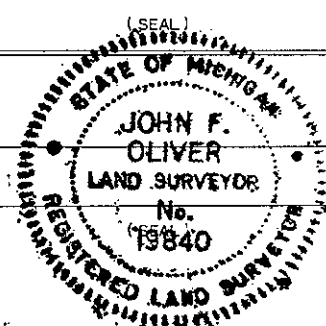

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_