

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>25N</u> N. S., R. <u>8E</u> E. W.	K-3
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ N. S., R. _____ E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. S., R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

APPROVED LAND CORNER
P A 345 of 1990
ALCONA COUNTY

Date 9/22/98
County Rep D.R. Co

0
Filed for Record in
ALCONA COUNTY MICHIGAN
DORIS A GAUTHIER
On 10-21-1998 At 11:21:26 a
LAND CORNER 9.00
OR


REGISTER OF DEEDS STAMP AND
FILING NUMBER

Alcona County Remonumentation Liber Page 297

SURVEY & REMONUMENTATION
NOV 25 1998

I, John F. Oliver do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on Oct. 6, 1998, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- K-3: 1843: GLO survey by J. Mullett - set post and referenced
 - 1956: survey by MDOT for M-171 - cor. is shown 2.85 ft E. of c/l
 - 1992: survey by D. MacNeill -cor. shown on survey -not described
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- K-3: found pavement box with 1/2" rod and cap
distances and alignment are compatible with MDOT data from 1956 Plans. Accepted as the correct location for the corner.
 - no evidence recovered from GLO survey of 1843
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- K-3: placed brass cap on the 1/2" rod in the pavement box referenced:
 - 7" Elm / N 78°W / 190.42 ft
 - pow. pole / S 55°E / 53.08 ft
 - pow. pole / N 23°E / 180.45 ft
 - fence post / N 60°W / 62.32 ft

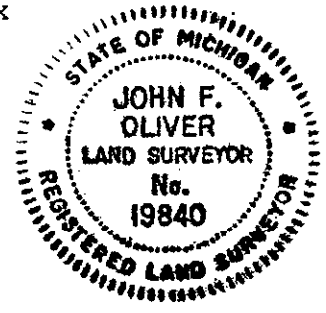

SIGNED BY John F. Oliver DATE Oct. 6, 1998
SURVEYOR'S MICHIGAN REGISTRATION NO. 1984 (SEAL)

FOR STATE AND UNITED STATES AGENCIES:
SIGNED BY _____ CHIEF OF SURVEY PARTY DATE _____
APPROVED AND SIGNED BY _____ MICHIGAN REGISTERED LAND SURVEYOR DATE _____ (SEAL)