

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

1998 Alcona County Remonumentation		
FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. <u>25N</u> N. S., R. <u>8E</u> E. W.	K-10
2. PROPERTY CONTROLLING IN SECTION_____	, T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION_____	, T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____	, RECORDED PLAT _____	_____
5. PRIVATE CLAIMS _____	_____	_____

Alcona County Remonumentation Liber Page 303

APPROVED LAND CORNER  
P 4 345 of 1990  
ALCONA COUNTY  
Date 9/22/98  
County Rep D.F. Oliver

Filed for Record in  
ALCONA COUNTY MICHIGAN  
DORIS A GAUTHIER  
On 10-21-1998 At 11:21:47 am.  
LAND CORNER 9.00  
OR  
REGISTER OF DEEDS STAMP AND FILING NUMBER

NOV 25 1998

## SECTION

I, John F. Oliver do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on Oct. 2, 1998, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- K-10; 1843: GLO survey by J. Mullett - set post and referenced
- 1903: survey by E. Chapelle - post - orig. wit. trees standing
- 1913: survey by A. Freer - cor. is gray boulder 16-7-7 with broken crockery under it
- 1956: survey by MDOT - no cor. shown - sta. on fences

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


K-10; found large "PK" nail at fences East and West as shown on MDOT Plans. accepted as the correct location for the cor.


no evidence recovered from GLO survey of 1843

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-10; placed pavement box with 1/2" rod and brass cap referenced:

- SE corner headwall / N 45°E / 41.76 ft
- pow. pole / East / 279.02 ft
- 20" tw. Maple / N 80°W / 138.25 ft
- 13" tw. Maple / N 50°W / 109.41 ft

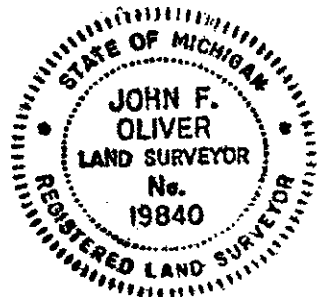

SIGNED BY  DATE Oct. 2, 1998  
John F. Oliver  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 19840 (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY  
 APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_