

FEB 07 2001

2000 Alcona County Remonumentation

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in
Alcona
(County)

Located In: Corner Code #

Alcona County
Remonumentation
Liber 2 Page 87

Filed for Record in
ALCONA COUNTY MICHIGAN
DORIS A GAUTHIER
On 09-20-2000 At 09:54 am.
LAND CORNER 9.00

- 1. Public Land Survey T 25NR 09E A-4
T 25NR 08E M-4 ✓
T R
T R
- 2. Property Controlling S T R
in Section S T R
- 3. Miscellaneous S T R
Property in Sec. S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Wayne T. Lewis, in a field survey on 3-30-2000, 19__ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													


A. Description of original monument and accessories and/or subsequent restoration:
1838 - Lewis Clason: Set post and witnessed
1903 - County Surveyor: Found post, no witnesses given
1996 - Northeast Land Surveys (Bill Woods, P.S.): Found 1/2" pipe, no witnesses given

APPROVED LAND CORNER
P A 345 of 1990
ALCONA COUNTY
Date: 9-6-2000
County Rep. W.T. Lewis

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
Found 1/2" pipe w/bent spike in top, 2' East of road c/l and 2' South of fence posts, East and West
This corner position is accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
2000 - Placed 3" Alcona County cap, stamped to identify the corner, on 1/2" rerod driven next to existing pipe

- Witnesses:
- N 80° E 56.26' 10" Cedar (exist. tag #22435)
 - S 70° E 48.13' 24" Hemlock (exist. tag #22435)
 - S 20° W 76.42' 10" White Pine (set tag #41922)
 - S 85° W 42.77' 10" Apple (exist. tag #22435)

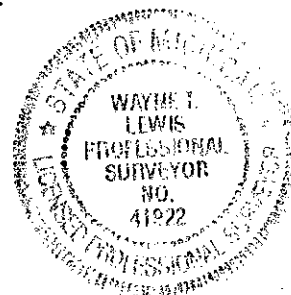

Signed by Wayne T. Lewis
Surveyor's Michigan License No. 41922

Date September 14, 2000