

SURVEY & REMONUMENTATION

1996 ALCONA COUNTY REMONUMENTATION CORNER
LAND CORNER RECORDATION CERTIFICATE

COMMISSION FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

RECORDED

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T27N ^{N.} S., R. 5E ^{E.} W.	J-7
2. PROPERTY CONTROLLING IN SECTION	, T. _____, ^{N.} S., R. _____ ^{E.} W.	
3. MISCELLANEOUS PROPERTY IN SECTION	, T. _____, ^{N.} S., R. _____ ^{E.} W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

Alcona County Remonumentation Liber 7 Page 181

RECORDED
 OCT 23 2 14 PM '96

John A. Gauthier
 REGISTERED LAND SURVEYOR

APPROVED LAND CORNER
 P A 345 of 1990
 ALCONA COUNTY

Date: 9-20-96
 County Rep. E.T.L.
 REGISTER OF DEEDS STAMP AND FILING NUMBER

I, John F. Oliver do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on Sept. 27 1996, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- 1848: G.L.O. Survey by T. Patterson - Set Post and Referenced Ironwood 4 / N42°W / 25 Cedar 6 / S20°E / 12
- 1978: Survey by N. Caldwell - Set 1/2" Bar and Cap
 N05°W / 41.4' / 15" W. Birch
 North / 37.0' / Fence Corner
 S25°E / 32.4' / Fence Corner


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- 1996: Found 1/2" Bar and Cap with the three accessories given by N. Caldwell in 1978 above.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- 1996: Replaced with Pavement Box containing a 1/2" Bar and Brass Cap to identify the Corner.
 Referenced -

- N60°W / 15" W. Pine / 81.70'
- N5°W / 15" W. Birch / 41.72'
- S25°E / Fence Corner Post / 33.60'
- N25°E / 14" R. Pine / 43.03"

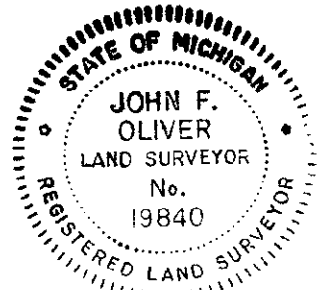

SIGNED BY *[Signature]* DATE 10-23-96

SURVEYOR'S MICHIGAN REGISTRATION NO. 19840 (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____