

FEB 07 2001

**LAND CORNER RECORDATION CERTIFICATE**

**SECTION FILING REQUIREMENT OF ACT 74, MICH. P.A.1970**

2000 Alcona County Remonumentation

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>27N</u> N. S., R. <u>8E</u> E. W.	<u>C-11</u> ✓
2. PROPERTY CONTROLLING IN SECTION	, T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION	, T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

Alcona County Remonumentation  
Liber 2 Page 62

Filed for Record in  
ALCONA COUNTY MICHIGAN  
DORIS A GAUTHIER  
On 09-20-2000 At 09:36 am.  
LAND CORNER 9.00

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, John F. Oliver do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on Aug. 10, 2000 established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- C-11: 1838: GLO sur. by L. Clason - set post and referenced
- 1913: sur. by A. Freer - corner is railroad iron 36" long with glass
- 1976: sur. by Porter's Survey - fd. PK nail
- 1993: sur. by NE land survey - fd. railroad spike
- 1996: sur. by J. Oliver - fd. 1/2" bar and cap

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

C-11: found railroad spike - nothing underneath

no evidence recovered from GLO sur. of 1838

previous witnesses from Porter's Survey verify location for the corner. distances and alignment are compatable with previous surveys of 1976, 1993 and 1996.

accepted as the correct location for the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-11: placed pavement box with 1/2" rod and brass cap referenced:

- 10" twin r. oak - S 05°W - 56.93 ft
- 11" r. oak - S 60°W - 70.41 ft
- 14" r. oak - N 26°W - 85.88 ft
- 12" r. oak - N 54°E - 96.18 ft
- 11" oak - N 04°E - 67.00 ft
- power pole - N 41°W - 65.73 ft

APPROVED LAND CORNER  
P A 345 of 1990  
ALCONA COUNTY  
Date 7-6-2000  
County Rep D.D.B. [Signature]


SIGNED BY \_\_\_\_\_ DATE Aug. 10, 2000

John F. Oliver  
SURVEYOR'S MICHIGAN REGISTRATION NO. 19840

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

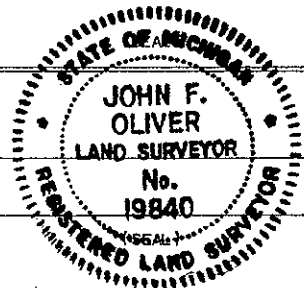

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_