

Approved by Alger County  
Land Survey Remonumentation  
Peer Group Under Act 345 of  
P.A. of 1970 On 3-22 1997

Donald Carlson  
Chairman

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

5-36

For corners in ALGER Located In: \_\_\_\_\_ Corner Code # \_\_\_\_\_  
(County)

1. Public Land Survey	T	<u>48N</u>	R	<u>15W</u>	J3
	T	_____	R	_____	_____
	T	_____	R	_____	_____
	T	_____	R	_____	_____
2. Property Controlling in Section	S	_____	T	_____	R
	S	_____	T	_____	R
3. Miscellaneous Property in Section	S	_____	T	_____	R
	S	_____	T	_____	R

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

FILED  
TIME 2:00 pm

MAR 31 1997

DONALD W. KINNUNEN  
REGISTER OF DEEDS  
ALGER COUNTY, MI

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3									●			
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Robert L. Jamros, in a field survey on October 22, 1996, 19\_\_\_\_\_, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

J3: PLS - George E. Adair, DS, 1851, Set quarter Section post \* Beech 16, N.76 E., 25 links \* Beech 18, S.56 W., 45 links \*\*\*\* Ray J. Brotherton, RLS, 1949. Set iron and post from remains of both original BT's. \* Witness: 6" Beech, N.43 1/2 E., 38 1/2 links. \* 9" Maple, S.34 W., 28 links. \* C.C.I.Co. Records. \*\*\*\* T.J. McClaren, C.C.I.Co., 1967. Verified reference trees of 1949 report and two others by John R. Radcliffe, RLS, 1966. \* C.C.I.Co. Records. \* Maple 6", S.45 E., 36 links. \* Beech 3", S.33 W., 49.8 links. \*\*\*\* Robert E. Schmeling, RLS, 1980. Found iron bolt and 1949 BT's. Beech 10", N.43 1/2 E., 38 1/2 links and Maple 9", S.34 W., 28 links (lay uprooted on ground- decayed). \* Set 1" diam. 4 foot long galvanized iron pipe with brass cap stamped to identify corner position. \* Witness's, Y. Birch 13", N.55 E., 28.3 feet, Scribed. \* Beech 26", S.85 E., 44.4 feet, Scribed. \* Hard Maple 9", S.06 E., 26.0 feet, Scribed. \* Y. Birch 18", S.56 E., 39.1 feet, Scribed. \* Recorded in L.1, P. 348, Alger County Records. \*\*\*\* No other subsequent restoration.


**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

J3: Located existing 1" galvanized iron pipe with brass cap with 3/4" iron bolt, 1 1/4" square head, at base and two existing BT's from 1980 report. \* Maple 10", S.06 E., 26.0 feet and Y. Birch 16", N.55 E., 28.3 feet, both with iron marks still visible. \* Also found two existing BT's from 1949 and 1966 reports. \* Beech 12", N.43 1/2 E., 38 1/2 links and Maple 12", S.45 E., 36 links, other two are lost. \* Monument as found is accepted as a careful and faithful perpetuation of the position of the original corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

J3: Stamped P.A. 345 in existing brass capped monument. Renewed existing reference trees w/ BT signs and paint. Established additional reference trees w/ BT signs, blazed, scribed and painted. Set PK nails for measure w/ Alum. I.O. washers in the following reference trees. \* Exist. BT, Maple 10", S.06 E., 25.95 feet, Marks visible, \* Exist. BT, Y. Birch 16", N.58 E., 28.43 feet, Marks visible. \* Beech 5", S.55 W., 24.78 feet, "1/4S BT". \* Beech 6", N.58 W., 21.55 feet, "1/4S BT". \* Survey marker sign on six foot steel post, S.51 E., 2.2 feet. \* All bearing are magnetic.

Signed by Robert L. Jamros  
Surveyor's Michigan License No. 25489

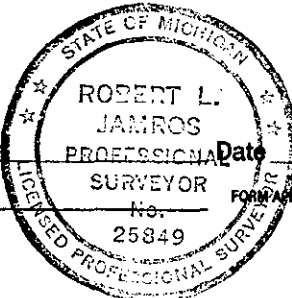

Date 25 March, 1997