

SURVEY & REMONUMENTATION

APR 24 1995

ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For Commission
COMMISSION
ALLEGAN
(County)

	Located In:	Corner Code #
1. Public Land Survey	T-1N R-12W	D-1 N1/4-5
	T- R-	OTSDGO TWP
	T- R-	
	T- R-	
2. Property Controlling in Section	S- T- R-	
	S- T- R-	
3. Miscellaneous Property in Sec.	S- T- R-	
	S- T- R-	

REGISTERED OFFICERS
ALLEGAN COUNTY, MICHIGAN

1994 AUG 16 AM 11:39

FILED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	16	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, BASTL ANDRESS, in a field survey on 7 APR, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

NOT SET BY G.L.O.
COUNTY SURVEYORS' OLD NOTES
IRON
FENCE POST S 27'
16" ELM SSE 29.5'
12" ELM NNW 28.4'
18" MAPLE N 43.3'
DIST. W TO NW COR. 2659.2'

APPROVED REMONUMENTATION CORNER
P.A. 345 OF 1990
ALLEGAN COUNTY
DATE APPROVED 3-9-94
COUNTY REP. [Signature]

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


FD. 3/4" IRON 0.16' SOUTH OF TOWN LINE.
DIST. W TO NW COR 2658.77'

THIS POSITION NOT ESTABLISHED BY ORIGINAL GOVERNMENT SURVEYORS. THIS MONUMENT IS ACCEPTED AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

REMOVED 3/4" IRON AND SET STD. ALLEGAN CO. MON. ON TOWN LINE 0.16' NORTH OF THE POSITION OF THE 3/4" IRON.

STD. ALLEGAN CO. MON. (S 1/4 SEC-32, T-2N, R-12W) EAST 73.87'
1/2" IRON W/ CAP SOUTH 33.16'
16d W/ REMON. TAG W SDE 4" THORNAPPLE SOUTH 43.09'
16d W/ REMON. TAG SW SDE 6" HICKORY S40E 43.76'
16d W/ REMON. TAG SW SDE 8" HICKORY N35W 44.65'
16d W/ REMON. TAG W SDE 6" HICKORY N35E 43.35'
IN LINE W/ OCCUPATION TO SOUTH

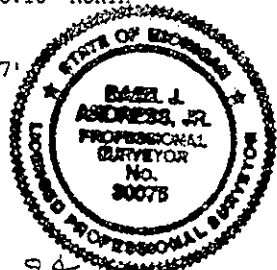

Signed by [Signature] Date 24 JUN 94
Surveyor's Michigan License No. 30075

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 23, 1971
REVISED MAY 14, 1975
REVISED JAN., 1985