

SURVEY & REMONUMENTATION

APR 07 1998

ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

SECTION
Allegan (County) Located In: Cheshire Corner Code #C-13

1. Public Land Survey	T 1N R 14W	SE COR SEC 31
	T R	C-13
	T R	CHESHIRE
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

REGISTER OF RECORDS
ALLEGAN COUNTY, MICHIGAN
Spencer A. Estlin


98 JAN 21 PM 1:18

FILED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Robert E. Lemke, in a field survey on April 20, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

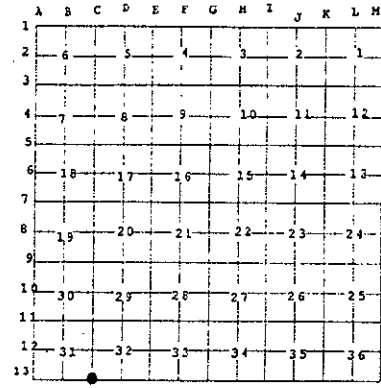

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

C-13 GLO 80.00 Set post May 1827 Beech Sinch N 80 2/3 E 25 LINKS Beech 5 inch N 81 1/2 W 14 LINKS May 8 th 1827 Wm. Brookfield	Act 132 survey Mitchell Surveys (job no 79-288) 6-14-79 P.P. S,SE 66.7 feet Street Sign NW 42.35 feet NW corner well pit SW 76.15 feet Found stone with crockery Set RR spike over	Survey Card Found RR spike March 1980 Same witness as Mitchell Survey
---	---	--

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found RR spike in gravel road, only remaining witness was NW corner well pit which measured 79.65. Measured west to S1/4 corner (ratified) a distance of 2630.18' (Mitchell 2630.24) and north to E1/4 corner a distance of 2637.75' (Mitchell 2638.00). Excavated 2' down: to find large quartz stone with no obvious chisel marks. Removed stone and found 1" diameter iron of great age. Iron has 1/2" by 1/2" square top. Iron is 2.4" below surface of gravel road.

And is accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set standard Allegan County monument (3/4" x 24" steel rod w/red cap #23520)

This monument is set over old iron and is 0.35' below surface of road.
Nail & Allegan Co. Remon Tag 0.5' above grade in NW side Power Pole S 15° W 66.87'
NW corner well pit S 65° W 79.65'
Nail & Allegan Co. Remon Tag 0.6' above grade in SW side of 10" Apple tree N 60° E 79.53'
NW corner of Pole Barn S 40° E 62.41'
1 1/2" pipe in SE corner Of 7' x 8' conc. Slab N35°W 84.33'

APPROVED REMONUMENTATION CORNER
P.A.345 OF 1990
ALLEGAN COUNTY
DATE APPROVED 6-10-97
COUNTY REP. K.V.O.

Signed by Robert E. Lemke
For SDI CONSULTANT,LTD

Date 12/31/97

Surveyor's Michigan License No. 40160

0006 PAGE 031