

**SURVEY &
REMONUMENTATION**

APR 25 1995

**ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

COMMISSION

<u>ALLEGAN</u> (County)	Located in:	Corner Code =#
1. Public Land Survey	T <u>1N</u> R <u>14W</u>	<u>D-1</u>
	T _____ R _____	<u>Cheshire Twp.</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

1994 DEC 16 AM 9:53
REGISTER OF DEEDS
ALLEGAN COUNTY MICH

FILED

Register of Deeds Stamp & File Number

I, Donald R. Pitts Jr., in a field survey on August 19, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2													
3													
4													
5													
6													
7													
8													
9													
10													
11													
12													
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O-Not set by Government
Allegan Co Surveyor Notes

- 1" Iron
- 10" Oak S.W. 58.9'
- 10" Pine S. 60.1
- 24" Pine S.E. 66.3'
- 8" W. Oak N.E. 78.9'
- 15" W. Cherry N. 66.2'
- 10" Hickory N.W. 73.3'

1973-Allegan Co. Surveyor, Donald A. Ratekin
L.C.R.C-Liber 2, Page 253
Found 1" Iron
Nail in 16" Cherry N.55°W. 67.03'
Nail in 14" Maple N.30°W. 49.08'
Nail in 22" Pine S.50°E. 67.69'


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1" Iron
Pulled Iron and set Standard Allegan Co. Remon. 3/4"X24" Iron with red cap 23520.
Traversed 2604' East & 2605' West
Approved by the Allegan Co. Remon. Peer Group on April 12, 1994, this position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner.

APPROVED REMONUMENTATION CORNER
P.A. 345 OF 1990
ALLEGAN COUNTY
DATE APPROVED 4-12-94
COUNTY REP. [Signature]

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Standard Allegan Co. Remon. 3/4"X24" Iron with Red Cap 23520
D-1, T.1N., R.14W., Standard Allegan Co. Remon 3/4"X24" Iron with Red Cap 23520, East 40.14'
Nail & Allegan Co. Remon. Tag N.E. Side 24" Pine S.55°E. 85.15'
" " " " " " N.W. Side 22" Oak S.05°W. 40.15'
" " " " " " S.W. Side 18" Cherry N.10°W. 46.75'

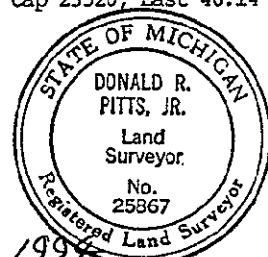

Signed by Donald R. Pitts Jr. Date 30 August 1994
Surveyor's Michigan License No. 25867

LIBER 0005 PAGE 009