

SURVEY & REMONUMENTATION

9-2

APR 25 1995

COMMISSION

ALLEGAN COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

ALLEGAN <small>(County)</small>	Located In:	Corner Code ##
1. Public Land Survey	T <u>1N</u> R <u>14W</u>	<u>E-1</u>
	T _____ R _____	<u>Cheshire</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

1994 DEC 16 AM 9 57
 J. A. ...
 REGISTER OF DEEDS
 ALLEGAN COUNTY MICHIGAN
 FILED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	16	17	18	19	20	21	22	23	24				
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							

I, Donald R. Pitts Jr., in a field survey on September 10, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
 G.L.O.-Intersect N. Boundary 5 Links E. of post & set post corner section 4 & 5
 Beech 8" S.26°W. 11 Links
 Pine 10" S.41°E. 22 Links
 1880-Allegan Co. Surveyor Notes
 Stone "X" No. Witnesses
 1973-Allegan Co. Surveyor, Donald A. Ratekin, L.C.R.C. Liber 2, Page 193
 Found Iron Per Allegan Co. Road Comm.
 P.K. Nail in 10" Oak N.10°E. 51.09' P.K. Nail in 8" Oak N.60°W. 63.11'
 P.K. Nail in P. Pole N.30°W. 62.86' 11" Spruce N.75°E. 62.51'


(CONTINUED ON BACK OF CERTIFICATE)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 Found 1/2" Iron
 Oak stump N.10°E. 51'
 P.K. in P. Pole N.30°W. 62.86'
 14" Spruce N.75°E. 62.5'
 Pulled Iron and set Standard Allegan Co. 3/4" X 24" Remon Iron W/Red Cap #23520
 Approved by the Allegan Co. Remon Peer Group on April 12, 1994, and is accepted as a careful and faithful perpetuation of the position of the original corner.

Traversed 2640' East & 2640' West

APPROVED REMONUMENTATION CORNER
 P.A. 345 OF 1990
 ALLEGAN COUNTY
 DATE APPROVED 4-12-94
 COUNTY REP. Frank L. Van Orden

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 Standard Allegan Co. Remon 3/4" X 24" Iron W/Red Cap #23520.
 E-13, T.2N., R.14W. Standard Allegan Co. 3/4" X 24" Remon Iron W/Red cap # 23520 West 3.40'
 Nail & Allegan Co. Remon Tag in S.W. Side Power Pole N.40°W. 62.91'
 " " " " " " " S. Side 14" Spruce N.70°E. 62.74'
 " " " " " " " S.E. Side 10" Red Pine S.60°W. 71.30'

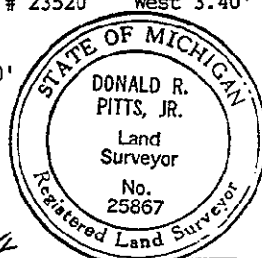

Signed by Donald R. Pitts Jr. Date 12 SEPT 1994
 Surveyor's Michigan License No. 25867

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983

(CONTINUED FROM FRONT OF CERTIFICATE)

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION.
1986-Raymond E. Moored, R.L.S.

Iron			
10" Oak	N.10°E.	51.09'	
P.Pole	N.30°W.	62.86'	
18" Oak	N.60W.	63.11'	
11" Spruce	N.75°E.	62.51'	