

REMONUMENTATION

APR 25 1995

COMMISSION

ALLEGAN COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

ALLEGAN (County)	Located In:	Corner Code #/
1. Public Land Survey	T <u>1N</u> R <u>14W</u>	<u>I-1</u> <u>Cheshire</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

James A. Blatter
REGISTER OF DEEDS
ALLEGAN COUNTY MICHIGAN

1994 DEC 16 AM 9:54

FILED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													


I, Donald R. Pitts Jr., in a field survey on September 17, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
G.L.O.-Intersect N. Boundary 18 Links West of post where section post corner Section 2 & 3
Beech 9" S.40°W. 31 Links
Pine 30" S.51°E. 26 Links
Circa 1900-Allegan Co. Surveyor
Stone
Pine Stump 20" N.19.
20" Oak N.E. 77
Allegan Co. Surveyor
Gas Pipe
Cherry S.E. 32.7
- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
Found 1/2" Iron W/Cap Kirk Van Order
Found 5/8" Iron in Mon. Box East 9.42'
Pulled Iron and Set Standard Allegan Co. 3/4" X 24" Remon Iron W/Red Cap #23520 in Mon. Box.
Approved by the Allegan Co. Remon. Peer Group on April 12, 1994, and is accepted as a careful and faithful perpetuation of the position of the original corner.
Traversed 2651' East and 2651' West

APPROVED REMONUMENTATION CORNER
P.A. 345 OF 1990
ALLEGAN COUNTY
DATE APPROVED 4-12-94
COUNTY REP. *Rick D. Van Orden*

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Standard Allegan Co. 3/4" X 24" Remon Iron W/Red Cap #23520 in Mon. Box.
I-13, T.2N., R.14W., Standard Allegan Co. 3/4" X 24" Remon Iron W/Red Cap #23520 in Mon. Box East 9.42'
Nail & Allegan Co. Remon. Tag in N.E. Side 30" Oak N.25°W. 65.15'
" " " " " " " " W. Side 12" Cherry N.15°E. 69.73'
" " " " " " " " N.E. Side Power Pole S.45°E. 50.45'

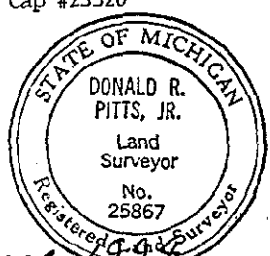

Signed by Donald R. Pitts Jr. Date 21 September 1994
Surveyor's Michigan License No. 25867

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1993

LIBER 0005 PAGE 012